Form 3160- 5 (August, 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT MAY 1 1 2011 5. Lease Serial No. NM 58878

FORM APPROVED OMB No. 1004-0137

Expires: July 31, 2010

	NDRI NOTICES AND					NIVI 38	
Do not use this form for proposals to drill or to resenter ann Field Offi abandoned well. Use Form 3160-3 (APD) for such proposals in Manage					16. If Indian, Allottee, or Tribe Name		
SUBMIT IN TRIPLICATE - Other Instructions on page 2.					7. If Unit or CA. Agreement Name and/or No.		
Type of Well			· · · · · · ·				
X Oil Well Gas Well	Other				8. Well Name and	No.	
Name of Operator					FEDERA	T L	#1
QEP ENERGY COMPANY					9. API Well No.		
3a. Address 1050 17TH STREET, SUITE 500				lude area code)		30-043-2	20825
DENVER, CO 80265			(303) 672-6900		10. Field and Pool, or Exploratory Area		
4. Location of Well (Footage, Sec., T., R.,	M., or Survey Description)		Lat.	36.19187	ALAMITO GALLUP		
ow or	1765' 28 T 23N R FEL	. 7W	Long.	-107.57707	11. County or Part	•	NEW MEXICO
12. CHECK APPROPRI	IATE BOX(S) TO INDICA	ATE NAT	URE OF NO	OTICE, REPORT, OI	R OTHER DAT	A	
TYPE OF SUBMISSION			-	TYPE OF ACTION			
X Notice of Intent	Acidize	Dee	pen	Production (St	art/ Resume)	Wate	er Shut-off
	Altering Casing	Fracture Treat		Reclamation		Well Integrity	
Subsequent Report	Casing Repair	New	Construction	Recomplete		Othe	r
1	Change Plans	X Plug	and abandon	Temporarily Al	bandon		
Final Abandonment Notice	Convert to Injection	Plug	back	Water Disposa	1		
In the event the casing reparately well, as seen in the attached. If you have any questions of	i Plug and Abandonment	t Proced	ure.		789,00	A121314 REC	415767778787878787878787878787878787878787
14. I hereby certify that the foregoing is true Name (<i>Printed/ Typed</i>) Sarah Boxley	and correct.		Title	Regula	tory Affairs, P	ermit A	gent
Signature Larah		2	Date		5/10/2011	<u> </u>	
	THIS SPACE F	OR FED	ERAL OR S	STATE OFFICE US	SE .		
	ned: Stephen Mason		Title		Dat	te	MAY 1 2 201
Conditions of approval, if any are attache certify that the applicant holds legal or en which would entitle the appli	quitable title to those rights in t	he subject					

States any false, fictitiousor fraudulent statements or representations as to any matter within its jurisdiction

Title 18 U.S.C. Section 1001 AND Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make any department or agency of the United

CASING REPAIR PROCEDURE

August 18, 2010

Federal I #1

Alamito Gallup 490' FSL & 1765' FEL, Section 28, T23N, R7W Sandoval, New Mexico, API #30-043-20825 Lat: 36.19187 / Long: -107.57707

Note: This procedure will immediately follow the casing repair in the event the casing repair is unsuccessful. All of the prep work for this procedure will be completed as part of the Casing Repair Procedure previously-submitted to your office.

- 1. Plug #1 (Gallup perforations and top, 4936' 4792'): PU and TIH with 4.5" cement retainer, set at 4936'. Pressure test tubing to 1000 PSI. Pressure test casing to 800 PSI. If casing does not test, then spot or tag subsequent plug as appropriate. Mix and pump 16 sxs Class B cement above CR to isolate the Gallup interval. PUH.
- 2. Plug #2 (Mancos top, 4164' 4064'): Spot 12 sxs Class B cement balanced plug inside casing to cover the Mancos top. PUH.

2445 2345

- 3. Plug #3 (Mesaverde top, 3200' 3100'): Spot 12 sxs Class B cement balanced plug inside casing to cover the Mesaverde top. PUH.
- 4. Plug #4 (Chacra top, 2037'- 1937'): Spot 12 sxs Class B cement balanced plug inside casing to cover the Chacra top. PUH.
- 5. Plug #5 (Pictured Cliffs, Fruitland, Kirtland, and Ojo Alamo tops, 1636' 914'): Spot 59 sxs Class B cement balanced plug inside casing to cover through the Ojo Alamo tops. PUH.
- 6. Plug #6 (8-5/8" Surface casing shoe, 262' to Surface): Perforate 3 squeeze holes at 262'. Establish circulation down 4.5" casing and out bradenhead. Mix and pump 100 sxs Class B cement down 4.5" casing and circulate good cement out casing valve and bradenhead. Shut in well and WOC.
- 7. ND BOP and cut off wellhead below surface casing flange. Install P&A marker with cement to comply with regulations. RD, MOL and cut off anchors. Restore location per BLM stipulations.

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

1235 LA PLATA HIGHWAY FARMINGTON, NEW MEXICO 87401

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment

Well: 1 Federal L

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 599-8907.
- 3. The following modifications to your plugging program are to be made:
- a) Place the Mesaverde plug from 2445' 2344'.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.