

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐ RECEIVED

2. NAME OF OPERATOR Kimbell Oil Company of Texas JUN 14 1985

3. ADDRESS OF OPERATOR Box 1097, Farmington, N. M. 87499 BUREAU OF LAND MANAGEMENT FARMINGTON RESOURCE AREA

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface:

1450' FSL & 1450' FEL Sec. 22, T25N, R6W

14. PERMIT NO. 15. ELEVATIONS (Show whether DF, RT, GR, etc.)
6641 Gr.

5. LEASE DESIGNATION AND SERIAL NO.

SF-080136

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME Salazar Federal

9. WELL NO. (Dual Compl. P.C.-Chacra)

10. FIELD AND POOL, OR WILDCAT S. Blanco P.C. & Otero Chacra

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 22, T25N, R6W

12. COUNTY OR PARISH Rio Arriba 13. STATE N. Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREAT

MULTIPLE COMPLETE

FRACTURE TREATMENT

ALTERING CASING

SHOOT OF ACIDIZE

ABANDON*

SHOOTING OR ACIDIZING

ABANDONMENT*

REPAIR WELL

CHANGE PLANS

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

This is a dual completed Pictured Cliffs-Chacra well and the packer was found to be leaking on a recent packer leakage test. It is intended to repair this leak in the following manner:

Move on Farmington Well Service rig - Blow well down and kill P.C. with water down casing - Kill Chacra with water down tubing. Close Otis side door choke on tubing and install a blow out preventer.

Pull and remove tubing - replace joint if a hole is found in tubing.

If no hole is found in tubing and it is determined the packer is leaking - Mill up Haliburton Model C non-retrievable packer and remove or push to bottom below casing perforations.

Run tubing back in and re-connect to old packer or run new packer as necessary.

Flange up well head and remove blow out preventer. Open ports on Otis choke and swab in Pictured Cliffs. Close ports on choke and swab in Chacra.

Shut well in and let pressure build on casing and tubing - check shut in pressure on both zones to determine if there is communication. Move off rig.

Put well on line and schedule for packer leakage test.

Clean location.

We will begin this work as soon as this notice of intention is approved and a rig is available.

APPROVED

18. I hereby certify that the foregoing is true and correct

SIGNED E. A. Clement

TITLE E. A. Clement, Agent

DATE 6-13-85

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

RECEIVED

JUN 18 1985

JUN 17 1985
DATE
AREA MANAGER
FARMINGTON RESOURCE AREA

*See Instructions on Reverse Side. DIV. 3