IJÜ

-					
ni 160-5	UNITED STATES		FORM APPROVED		
NE 1990)	DEPARTMENT OF THE INTI	ERIOR	Budget Bureau No. 1004-0135		
	BUREAU OF LAND MANAG	EMENT	Expires: March 31,1993		
			5. Lease Designation and Serial No.		
SUNDRY NOTICES AND REPORTS ON WELLS			SF-079600		
Do not use i	chis form for proposals to drill or to deep Use "APPLICATION FOR PERMIT" for	6. If Indian, Allottee or Tribe Name			
SUBMIT IN TRIPLICATE			7. If Unit or CA, Agreement Designation		
1. Type of	Well				
Oil S Gas Other INJECTION WELL			8. Well Name and No.		
2. Name o	of Operator		C.W. Roberts #2		
TEXACO EXPLORATION AND PRODUCING INC.			9. API Weil No.		
	s and Telephone No.		3003905987		
3300 N. BUTLER, FARMINGTION, N.M. 87401 (505)325-4397			10. Field and Pool, or Exploratory Area		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)			BASIN FRUITLAND COAL		
			11. County or Parish, State		
1650' FSL, 990' FWL, SECTION 18, T25N, R3W			RIO ARRIBA, NEW MEXICO		
2.	CHECK APPROPRIATE BOX(s)	TO INDICATE NATURE OF NOTICE, REPORT	, OR OTHER DATA		
TYF	PE OF SUBMISSION	TYPE OF ACTION	1		

TYPE OF SUBMISSION	TYPE OF ACTION	
X Notice of Intent	X Abandonment Recompletion	Change of Plans New Construction
Subsequent Report	Plugging Back Casing Repair	Non-Routine Fractur Water Shut-Off
Final Abandonment Notice	Altering Casing Other	Conversion to Inject Dispose Water
		(Note: Report results of multiple completion on w Completion or Recompletion Report and Log form

Texaco proposes to plug and abandon the subject well. See the attached procedure and wellbore diagrams for pertinent details. Tentative start date is October 1,1994

NOV - 8 1994

			1	
14. I hereby co	ertify that the forgoing is true and correct	Title Area Manager	Date	9/2/94
(This space for Aproved by Conditions of ap	Federal or State office use)  (ORIG. SGD.) ROBERT A. KENT  oproval, if any:	Chief, Lands and Mineral Existences Title	Date	<b>ٻ</b> وڙڙ ن
	1001, makes it a crime for any person knowingly and willfully to	make to any department of agency of the United States any false, lictitious or fraud	ulent statement	5

#### C.W. Roberts #2

### PLUG AND ABANDONMENT PROCEDURE


- 1. MIRUSU. Remove wellhead. NUBOP. Notify BLM to witness
- 2. POOH w/ TBG. GIH w/ 5-1/2" CIBP on 2-3/8" TBG. Set CIBP @ 3350'. Spot "G" CMT from 3090'-3350' (~30 sx or 6 Bbls).
- 3. Spot WTR from 2076'-3090' (~26 Bbls). POOH
- 4. Perforate CSG w/ 2 JSPF @ 2075'-2076'. Establish rate and pressure through perfs.
- 5. GIH w/ 5-1/2" CMT RET on 2-3/8" TBG. Set RET @ 2026'. Pump 56 sx (~12 Bbls) "G" CMT through RET. Sting out and spot "G" CMT from 1976'-2026' (~ 6 sx or 1 Bbl).
- 6. Spot WTR from 300'-1976' (~41 Bbls). POOH.
- 7. Perforate CSG w/ 2 JSPF @ 298'-299'. Circulate CMT to surface and spot CMT in CSG from surface to 300'.
- 8. Remove all surface equipment. Reclaim location. Erect P & A marker.

**NOTE:** All depths measured from KB or 6' above GL.



## C.W. ROBERTS No. 2

### **Current Completion**

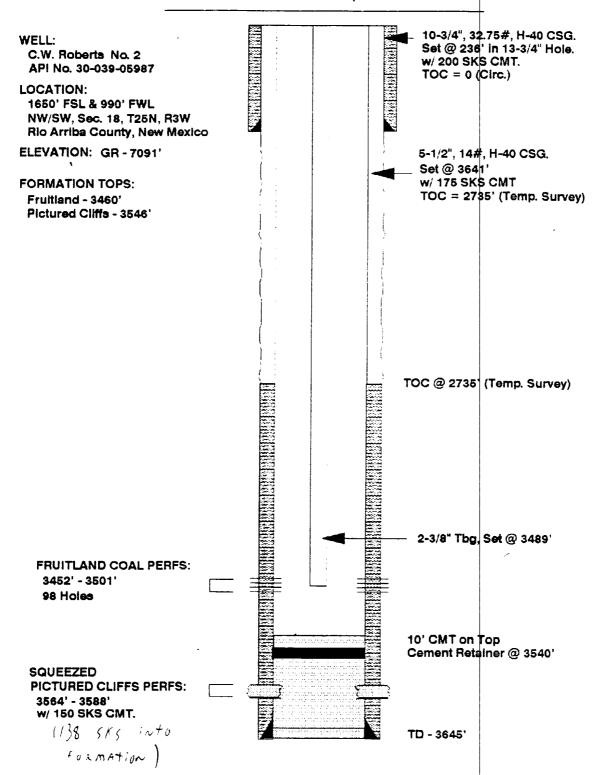



# C.W. ROBERTS No. 2

## Proposed Plug and Abandonement

