

San Juan Basin Well Work Procedure

Well Name: Jicarilla Contract 148- 37
Version: #1
Date: 3/25/2002
Budget: DRA
Repair Type: TXA

Objectives:

1. TXA wellbore and perform mechanical integrity test. Hold for rehabilitation of the GP/DK or future Chacra recompletion.

Pertinent Information:

Location:	Sec 13 T25N R5W	Horizon:	Basin Dakota
County:	Rio Arriba	API #:	30-039-23786
State:	New Mexico	Engr:	Allen Kutch
Lease:		Phone:	(281)366-7955
Well Flac:	84657902		
Lease Flac:	290476	SAP	X7-000PT

Economic Information:

APC WI: 1.00
Estimated Cost: \$10,000

Formation Tops: (Estimated formation tops)


Nacimiento:	Menefee:	
Ojo Alamo:	Point Lookout:	5804
Kirtland Shale:	Mancos Shale:	
Fruitland:	Gallup:	6998
Pictured Cliffs:	Graneros:	
Lewis Shale:	Dakota:	7836
Chacra: 4540	Morrison:	
Cliff House:		

Bradenhead Test Information:

Test Date: Tubing: Casing: BH:

Time	BH	CSG	INT	CSG
5 min				
10 min				
15 min				

Comments:

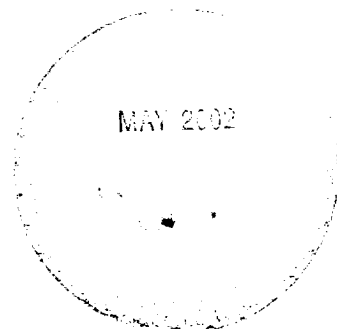

Temporary abandonment procedure

1. Contact Federal and State agencies prior to starting work (NMOCD Charlie Perrin, 505-334-6178 X16, BLM Brian Davis 505-761-8756).
2. Check location for anchors. Install if necessary. Test anchors.
3. MIRUSU. Check and record tubing, casing and bradenhead pressures.
4. Blow down well and kill well, if necessary, with lease water.
5. ND wellhead. NU BOP's.
6. POOH with 2-7/8" tbg, visually inspecting.
7. Make bit x scraper run.
8. TIH with CIBP on tbg. Set CIBP at 6950'.
9. Load csg with inhibited lease water.
10. Attach chart recorder. Test casing to 550 psi for 30 minutes. Fax copy of chart to 281-366-0700, attention Allen Kutch.
11. RIH with 2-7/8" tbg. ND BOP, NU WH.
12. RDMO SU.

Jicarilla Contract 148-37 - Proposed TXA Configuration 3-25-2002
Rio Arriba County, NM
Unit C Section 13 T25N - R5W
Run 65

KB: 13' above GL

