Form 3160-5 (November 1994)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

FORM APPROVED Budget Bureau No. 1004-0135 Expires July 31, 1996

5. Lease Serial No.

Tract	251	Contract	15
iract	ZDI	LONTRACT	TD

SUNDRY NOTICES	36 Tract						
Do not use this form for p abandoned well. Use Form	i	6. If Indian, Allottee or Tribe Name					
abandoned Wen. Cool on	NM Jicar	Jicarilla Apache					
abandoned well. Use Form SUBMIT IN TRIPLICATE - 1. Type of Well	Other instructions on reven	Se state Will to	7. 11 0	Init or CA/Agreement, Name and/or No.			
			1				
Oil X Gas Well Other		I Name and No. 111a Apache 8E					
2. Name of Operator American Marathon 011 Company	DHC #	1108					
3a. Address	jab. Phon	e No. (include area code)		Well No. 9-22588			
P.O. Box 2409 Hobbs, NM 88240	10. Fig	eld and Pool, or Exploratory Area					
4. Location of Well (Footage, Sec., T., R., M., or Survey Descrip UL K, Sec. 27, T-26-N, R-5-W	Jicar Basin	Dakota / Mesa Verde					
1685' FSL and 1685' FWL	I	ounty or Parish, State					
			R10 A	rriba NM			
12. CHECK APPROPRIA	ATE BOX(ES) TO INDICATE	NATURE OF NOTICE	REPORT, OR OTH	HER DATA			
TYPE OF SUBMISSION TYPE OF ACTION							
Notice of Intent	Acidize []	Deepen	Production (Start/Re	sume) Water Shut-Off			
	Alter Casing F	Fracture Treat	Reclamation	Well Integrity			
X Subsequent Report	Casing Repair	New Construction	Recomplete	X Other			
Final Abandonment Notice	Change Plans	Plug and Abandon	Temporarily Abando	on			
	Convert to Injection	Plug Back	Water Disposal				
following completion of the involved operations. If testing has been completed. Final Abandonment No determined that the final site is ready for final inspection Marathon Oil Company proposes to of tubing to more efficiently dow (Downhole Commingle No. 1108.) Please see the attachment for sum 1998 to November 24, 1998.	pull the coil tubing a mhole commingle the ab	and release the pove referenced	packer, and r	een completed, and the operator has			
14. I hereby certify that the foregoing is true and correct Name (Printed/Typed);	Title	Records Processor					
	Date	12/11/98					
THIS SPACE FOR FEDERAL OR STATE OFFICE USE							
Approved by		Title Lands and	Mineral Resou	irce gate JAN 1 5 1999			
Conditions of approval, if any, are attached. Approval of certify that the applicant holds legal or equitable title to which would entitle the applicant to conduct operations thereon	those rights in the subject lease	Office		•			

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Jicarilla Apache Well No. 8E UL 'K', Sec 27, T-26-N, R-5-W 1685' FSL and 1685' FWL Rio Arriba County, NM

Work performed from October 28, 1998 to November 24, 1998

RU Dowell CTU. Kill well. NU BOP and injector head. POOH w/ 1.5" coil tubing. ND injector head and BOP. RDMO CTU.

MIRU PU and equipment. Blew well down.

ND wellhead and NU BOP.

Work tubing up to 55,000#. Tubing stuck.

RU Weatherford. RIH w/ free point tool. Top packer free.

RIH and chemical cut tubing at 7187'. RD Weatherford.

POOH. PU overshot. TIH to top of fish.

Latch onto fish. Work packer, but packer would not release.

Release overshot. POOH.

Pick up mill shoe, 1 jt washpipe and 2-3/8", N-80 work string.

TIH to top of fish. Broke circulation with air unit.

Wash fill out and milled over top part of packer.

POOH. TIH with overshot & jars.

Jarred packer loose. POOH.

PU 3-7/8" bit. TIH and tagged PBTD 7532'.

Broke circulation and unload well.

POOH. LD 2-3/8", N-80 work string.

PU packer and RBP. TIH with 2-3/8", J-55 tubing.

Set packer at 7165'.

Acidized Perfs from 7250' - 7490' w/ 700 gallons of 15% HCl.

Release packer and pull up hole.

Set RBP at 5385'. PUH 1 jt and set packer.

Test RBP to 500 psi. Held OK.

Release packer and PUH. Set packer at 5175'.

Acidized Perfs from 5250' - 5312' w/ 1300 gallons of 15% HCl.

Release packer. RIH. Latch and release RBP at 5385'.

POOH. LD packer and RBP.

PU notched collar and SN. TIH and tagged at 7504'.

Break circulation with air unit. Clean out to PBTD at 7532'.

RD air unit. Swab well.

LD 4 jts. ND BOP and NU wellhead.

Land SN at 7415' on 2-3/8" tubing.

Hook up to surface equipment.

RDMO PU and equipment.