

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

| | | |
|---|--|---|
| 1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER | | 5. LEASE DESIGNATION AND SERIAL NO. Jic cont 109 |
| 2. NAME OF OPERATOR Tenneco Oil Company | | 6. IF INDIAN, ALLOTTEE OR TRIBE NAME Jicarilla |
| 3. ADDRESS OF OPERATOR P. O. Box 3249, Englewood, CO 80155 | | 7. UNIT AGREEMENT NAME |
| 4. LOCATION OF WELL (Report location clearly and in accordance with State requirements. See also space 17 below.) At surface 1695' FSL, 1545' FWL | | 8. FARM OR LEASE NAME Jicarilla B |
| 14. PERMIT NO. | | 9. WELL NO. 5E |
| 15. ELEVATIONS (Show whether FARMINGTON RESOURCE AREA) 6612' GR | | 10. FIELD AND POOL, OR WILDCAT Basin Dakota |
| | | 11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 21, T26N R5W |
| | | 12. COUNTY OR PARISH Rio Arriba |
| | | 13. STATE NM |

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANE

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT*

(Other) Check casing leak

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

10/23/85 MIRUSU. Kill well w/1% KCl. NDWH. NUBOP. Could not unseat lokset pkr. Stuck @ the pkr w/fill RIH w/HOMCO WL. Freept tbg. Free @ 4817'. RIH w/acid cutter. Cut tbg. @ 4786'. Talley OOH w/tbg, blast jts & perf'd jt. RIH w/RBP, pkr. Set TBP @ 4745' & pkr @ 4715'. Press tstd pkr to 1500 psi, and BS to 1500 psi. Both held Release both. POOH w/tbg & pkr.

10/24/85 RIH w/tbg and tbg patch. Space out and land the tbg w/5 pts on the patch. NDBOP. NUWH. RDMOSU.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Senior Regulatory Analyst

DATE 10/25/85

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side