Form 9-331 (May 1963)

ī.

2.

16.

UNITED STATES SUBMIT IN TRIPLICATE* DEPARTMENT OF THE INTERIOR (Other instructions on reverse side)

Form approved, Budget Bureau No. 42-R1424. 5. LEASE DESIGNATION AND SERIAL NO.

GEOLG	E. W. Mudge No. 1 SF 078063	
SUNDRY NOTICES (Do not use this form for proposals to Use "APPLICATION I	6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
OIL GAS OTHER	7. UNIT AGREEMENT NAME Carson Unit	
2. NAME OF OPERATOR Shell Oil Company	S. FARM OR LEASE NAME	
3. ADDRESS OF OPERATOR	9. WELL NO.	
1700 Broadway, Denver, Colo	44-17	
 LOCATION OF WELL (Report location clearly a See also space 17 below.) At surface 	10. FIELD AND FOOL, OR WILDCAT Bisti	
710' FSL & 710' FEL Section	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Section 17-T25N-R11W	
14. PERMIT NO. 15. E	ELEVATIONS (Show whether DF, RT, GR, etc.)	12. COUNTY OR PARISH 13. STATE
	6430 KB	San Juan N.M.


Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:			SUBSEQUENT REPORT OF:		
					
TEST WATER SHUT-OFF		PULL OR ALTER CASING		WATER SHUT-OFF	REPAIRING WELL
FRACTURE TREAT		MULTIPLE COMPLETE		FRACTURE TREATMENT	ALTERING CASING
SHOOT OR ACIDIZE		ABANDON*	<u> </u>	SHOOTING OR ACIDIZING	ABANDONMENT* X
REPAIR WELL		CHANGE PLANS		(Other)	ultiple completion on Well
(Other)				Completion or Recompletion	ultiple completion on Well Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OFFRATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

See attachment

WILL SEND FINAL SUNDRY WHEN LOCATION CLEANED AND READY FOR INSPECTION

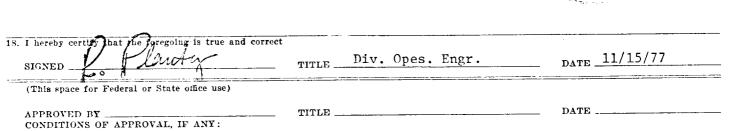

NMO&GCC

WELL P&A		
SHELL OIL COMPANY	LEASE CARSON UNIT WELL	BISTI
FROM: 10/19/77	DIVISION WESTERN ELEV	0420 KB
	STAT	TENEW MEXICO

NEW MEXICO
BISTI FIELD
Carson Unit 44-17
(P&A)

"FR" TD 5075. PB 4968. AFE #571166 provides funds to plug & abandon well. 10/13 Ran tbg to PBTD. Circ'd hole w/gel. Spt'd 15 sx cmt plug over & across Gallup perfs. Pulled 50 jts tbg out of well. 10/14 Fin'd pulling tbg & set jacks. 10/15 Perf'd csg @ 1210'. Placed 50 sx cmt & sqz'd 20 sx over Pictured Cliffs & Fruitland Coal. Shot csg @ 770'. Pulled csg to 500'. Placed 35 sx cmt plug over Ojo Alamo Sd. Pulled csg to 176'. Placed 25 sx cmt plug over sfc csg stub. Pulled csg out of well. Placed 10 sx cmt plug on sfc. Set abandonment marker & RD Bedford. FINAL REPORT