## UNITED STATES DEPARTMENT OF THE INTERIOR

## BUREAU OF LAND MANAGEMENT

			Notices and Repor				
. туг	oe of We	11				.6	Lease Number SF-047017-B If Indian, All Tribe Name
	me of Op					言同	Jnit Agreement
. Hai		INGTON		m	EGEIV		
F	ESO	URCES	OIL & GAS COMPANY	121,	1 6 19	198 1	
		.,,,,		<u> </u>	MOA 1 0		ell Name & Nu
. Add	iress &	Phone No. of O	perator	226 070	all Collo	שוופן	Aggel Peak B # API Well No.
P	) BOX 42	89, Farmington	, NM 87499 (505)	326-9700	PUBLIC SUBJECT TO	3. (	30-045-24360
. Lo	ation o	f Well, Footag	e, Sec., T, R, M		. Busine	10. I	Field and Pool
790	)'FSL 79	0'FEL, Sec.25,	T-28-N, R-11-W, I	MPM		11. (	Basin Dakota County and Sta San Juan Co, N
			O INDICATE NATURE			THER D	PATA
Туј		ubmission otice of Intent		<b>Type of A</b> o ment	change of	E Plan	ıs
	_^_ 100	refer of intent		_	New Const		
	Su	ıbsequent Repor			Non-Rout:		
		nbsequent Repor	Casing	Repair g Casing _	Water Shu Conversion	ıt off	
3.	Fi	nal Abandonmen	Casing t	Repair g Casing _ Tubing re	Water Shu Conversion	ıt off	
3.	Fi	nal Abandonmen	Casing t  Altering  X Other -  Completed Operation  air the tubing on	Repair _ g Casing _ Tubing re	Water Shu Conversion	ut off	Injection
3.	Fi	nal Abandonmen  oe Proposed or  ntended to rep	Casing t  Altering  X Other -  Completed Operation  air the tubing on	Repair _ g Casing _ Tubing re	Water Shu Conversion	ut off	Injection
3.	Fi	nal Abandonmen  oe Proposed or  ntended to rep	Casing t  Altering  X Other -  Completed Operation  air the tubing on	Repair _ g Casing _ Tubing re	Water Shu Conversion	ut off	Injection
3.	Fi	nal Abandonmen  oe Proposed or  ntended to rep	Casing t  Altering  X Other -  Completed Operation  air the tubing on	Repair _ g Casing _ Tubing re	Water Shu Conversion	ut off	Injection  To the
3.	Fi	nal Abandonmen  oe Proposed or  ntended to rep	Casing t  Altering  X Other -  Completed Operation  air the tubing on	Repair _ g Casing _ Tubing re	Water Shu Conversion	ut off	Injection  To the
3.	Fi	nal Abandonmen  oe Proposed or  ntended to rep	Casing t  Altering  X Other -  Completed Operation  air the tubing on	Repair _ g Casing _ Tubing re	Water Shu Conversion	ut off	Injection  To the
3.	Fi	nal Abandonmen  oe Proposed or  ntended to rep	Casing t  Altering  X Other -  Completed Operation  air the tubing on	Repair _ g Casing _ Tubing re	Water Shu Conversion	ut off	Injection
3.	Fi	nal Abandonmen  oe Proposed or  ntended to rep	Casing t  Altering  X Other -  Completed Operation  air the tubing on	Repair _ g Casing _ Tubing re	Water Shu Conversion	ut off	Injection  To the
3.	Fi	nal Abandonmen  oe Proposed or  ntended to rep	Casing t  Altering  X Other -  Completed Operation  air the tubing on	Repair _ g Casing _ Tubing re	Water Shu Conversion	ut off	Injection  to the Color Anna Calculation of the Calculatio
3.	Describ	nal Abandonmen  oe Proposed or  ntended to rep attached proce	Casing t Altering X Other -  Completed Operations on edure.	Repair _ g Casing _ Tubing re	Water Shu Conversion epair ect well acco	ut off	Injection  to the Color Anna Calculation of the Calculatio
	Describ	nal Abandonmen  oe Proposed or  ntended to rep attached proce	Casing t  Altering  X Other -  Completed Operation  air the tubing on	Repair _ g Casing _ Tubing re	Water Shu Conversion epair ect well acco	ut off	Injection  to the Color Anna Calculation of the Calculatio
4.	Describ	nal Abandonmen  oe Proposed or  ntended to rep attached proce	Casing t Altering X Other -  Completed Operation of the tubing on edure.	Repair g Casing Tubing re ons the subjective	Water Shu Conversion epair ect well acco	ording	Injection  to the Colon Annual Colon NM
3.	Describ	nal Abandonmen  oe Proposed or  ntended to rep attached proce	Casing t Altering X_ Other -  Completed Operation air the tubing on edure.  the foregoing is	Repair g Casing Tubing re ons the subjective	Water Shu Conversion epair ect well acco	ording	Injection  to the Colon Annual Colon NM
4.	Describ	nal Abandonmen  oe Proposed or  Intended to rep attached proce	Casing t Altering X Other - X Other - Completed Operation air the tubing on edure.  the foregoing is KLM2) Title	Repair g Casing Tubing re ons the subjective	Water Shu Conversion epair ect well acco	ording	Injection  To the OTO FALLE 2: 15

## Angel Peak B #26E

Dakota

790' FSL and 790' FEL

Unit P, Section 25, T28N, R11W

Latitude / Longitude: 36° 37.6849'/ 107° 56.8964'

DPNO: 32151A **Tubing Repair Procedure** 

Project Summary: The Angel Peak B #26E was drilled in 1980. The tubing has not been pulled since originally installed. We propose to pull the tubing, check for fill, replace any worn or scaled tubing and add a plunger lift.

- 1. Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Test rig anchors and build blow pit prior to moving in rig. Notify BROG Regulatory (Peggy Bradfield 326-9727) and the appropriate Regulatory Agency prior to pumping any cement job. If an unplanned cement job is required, approval is required before the job can be pumped. If verbal approval is obtained, document approval in DIMS/WIMS. Allow as much time as possible prior to pump time in case the Agency decides to witness the cement job.
- 2. MOL and RU workover rig. Obtain and record all wellhead pressures. NU relief line. Blow well down and kill with 2% KCL water if necessary. NU BOP with stripping head. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary.
- The Dakota tubing is 2-3/8", 4.7#, J-55 set at 6237', seating nipple at 6206'. Release donut, pick 3. up additional joints of tubing and tag bottom (record depth.) PBTD should be at +/- 6502'. TOOH with tubing. Visually inspect tubing for corrosion and replace any bad joints. Check tubing for scale build up and notify Operations Engineer.
- 4. If fill covers any perforations then TIH with 3-7/8" bit and a watermelon mill on 2-3/8" tubing to below perforations, cleaning out with air/mist. PU above the perforations and flow the well naturally, making short trips for clean up when necessary. TOOH with tubing. NOTE: When using air/mist, minimum mist rate is 12 bph.
- TIH with one joint of 2-3/8" tubing with an expendable check on bottom and a seating nipple one 5. joint off bottom. Run a broach on sandline to insure that the tubing is clear. Land tubing at approximately 6240'. ND BOP and NU WH. Pump off expendable check. Connect to casing and circulate air to assure that expendable check has pumped off. If well will not flow on it's own, make swab run to SN. RD and MOL. Return well to production.

6. Production operations will install the plunger lift.

Recommended: Mullip 10/21/98 Approved: Bruce () Bown 10 10 93
Operations Engineer Drilling Superintendent

Kevin Midkiff Office - 599-9807

Pager – 564-1653