Form 3160-5 (June 1990)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS		
		5. Lease Designation and Serial No.
	NM 0309374	
Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.		6. If Indian, Allottee or Tribe Name
Use "APPLIC	ATION FOR PERMIT - " for such proposals.	
	The state of the s	7. If Unit or CA, Agreement Designation
	1	
1. Type of Well		·
Oil Gas Other		8. Well Name and No.
2. Name of Operator Attention:		G. L DAVIES 1 E
AMOCO PRODUCTION COMPANY Lois Raeburn		9. API Well No.
3. Address and Telephone No.		3004526212
P.O. Box 800, Denver, Colorado 80201 (303) 830-5294		10. Field and Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)		GALLUP/ DAKOTA
4. Location of Well (Footage, Sec., 1., N., W., or Survey Description)		11. County or Parish, State
1570'FSL		
		SAN JUAN New Mexico
12. CHECK APPROPRI	IATE BOX(s) TO INDICATE NATURE OF NOTICE, F	REPORT OR OTHER DATA
TYPE OF SUBMISSION		
THE OF SUBMISSION	TIPE OF ACTION	
	⊠	1
Notice of Intent	Abandonment	Change of Plans
	Recompletion Plugging Back	New Construction Non-Routine Fracturing
Subsequent Report	Casing Repair	Water Shut-Off
	Altering Casing	Conversion to injection
Final Abandonment Notice	Other	Dispose Water
		ort results of multiple completion on Well Completion or ion Report and Log form.)
12. Describe Described Constitution		
	(Clearly state all pertinent details, and give pertinent dates, including estimated date of startin evertical depths for all markers and zones pertinent to this work.)*	g any proposed work . If well is directionally drilled, give
AMOCO PRODUCTION COM	PANY REQUEST PERMISSION TO PLUG AND ABANDON THE	SUBJECT WELL.
SEE ATTACHED PROCEDUR	ES.	
•		
		D 1900
		IDI IS PARIS
		以中の同川 がほり
		UU ADD
		PECETVED APR - 5 1995
		OIL CON. DIV.
9		ART (2(0) WI LEADER
		Phone DIV
		நாறுடு இ

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any faile, fictiblious or neudoient statements or representations as to any matter within its jurisdiction.

* See Instructions on Reverse Side

NMOCD



PXA Procedures G.L. Davis 1E

- 1. Check location for anchors. Install if necessary. Test anchors.
- 2. MIRUSU. Blow down well. Kill if necessary with fresh water. NDWH. NUBOP.
- 3. POOH with 2 3/8" tbg. RIH with tbg and cement retainer. Set retainer at 6100'. Set retainer at 5225'. Test casing integrity to 500#. Squeeze pers at 6159 with 72 cuft cement. Pull out of retainer. Squeeze perfs at 5288 ' to 5566' with 210 cuft cement. Pull out of retainer and spot 50' of cement on top of retainer. (5 cuft cement)
- 4. Pull up hole and spot 100' cement plugs at the following locations:

Mesa Verde at 3127'
Pictured Cliffs at 1547'
Fruitland at 1218
and 587 to surface to cover the water zones
(84 cuft cement)

- 5. NDBOP. Cut off casing and wellhead. Install PXA marker according to BLM or State requirements.
- 6. Turn over to John Schwartz for reclamation.
- 7. Rehabilitate location according to BLM or State requirements.