## STATE OF NEW MEXICO ENERGY, MINERALS AND NATURAL RESOURCES DEPARTMENT

Form C-103

Revised 1-1-89

## OIL CONSERVATION DIVISION

1000 BRAZOS RD. AZTEC, NM 87410

Appropriate District Office	WELL APLNO 30.030	WELL API NO. 30-039-24777			
DISTRICT 2 P O Box 1980, Hobbs, NM 88240 DISTRICT 2 P O Drawer DD, Artesia, NM 88210 DISTRICT 3 1000 Rio Brazos Rd., Aztec, NM 87410	971.7	CT LOT			
	5. Indicate Type of Lease STAT.  6. State Oil & Gas Lease No. E-347-				
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)	1	7. Lease Name or Unit Agreement Name			
	O E	ROSA	UNIT		
1. Type of Well: OIL WELL I GAS WELL OTHER I				<u> </u>	
2. Name of Operator WILLIAMS PRODUCTION COMPANY	8. Well No. 334		JUN 2500		
3. Address of Operator P O BOX 3102, MS: 37-2, TULSA, OK 74101	9. Pool Name or Wildcat BASIN FRUITLA	ND COAL	Carlos my		
4. Well Location Unit Letter A: 1025 Feet From The NORTH Line and 790	Feet From The <u>EAST</u> Line		The second	J.	
Section 32 Township 31N Range 5W NMPM RIO A	RRIBA_COUNTY	·			
	10. Elevation (Show whether DF, RKE 6581' GR	, RT, GR, etc.)			
CHECK APPROPRIATE BOX TO IN	DICATE NATURE OF NOTICE, REPORT, OR	THER DATA			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:			
PERFORM REMEDIAL WORK   C   PLUG AND ABANDON   C   CHANGE PLANS   C   OTHER	Γ REMEDIAL WORK Γ COMMENCE DRILLING OPINIONS Γ CASING TEST AND CEMENT JOB	г г	ALTERING CASING PLUG AND ABANDONMENT OTHER	г г г	
	CASING TEST AND CEMENT JOB				
12 Describe Proposed or Completed Operations (Clearly state all pertinent details, and		rting any propose	<u> </u>		
12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and O5/15/00: RU rig & lay lines. SICP = 130 psi, SITP = 120 psi, blow well do NDBOPs, ND tbg head, NU new 11" 3M x 7 1/16" 3M tbg head w/3 1/8" RBP. Blow well down, TOOH laying down w/RBP. Pooh laying down w/1	give pert nent dates, including estimated date of statement own. NDWH, NUBOPs, unseat donut. 2m csg valves, pres test tbg head to 15 07 jts 2 3/8" tbg. SWIFN	TIH & set 7' 00 psi –ok- 1	kd work) SEE RULE 1103. " RBP @ 180', TOOH w/settin NUBOPs. TIH w/ret tool, latch of	g tool. onto & rel	
05/15/00: RU rig & lay lines. SICP = 130 psi, SITP = 120 psi, blow well do NDBOPs, ND tbg head, NU new 11" 3M x 7 1/16" 3M tbg head w/3 1/8"	give pert nent dates, including estimated date of state own. NDWH, NUBOPs, unseat donut. 2m csg valves, pres test tbg head to 15.07 jts 2 3/8" tbg. SWIFN tbg, tag PBTD @ 3404'. Land tbg in 1	TIH & set 7' 00 psi –ok- 1	kd work) SEE RULE 1103. " RBP @ 180', TOOH w/settin NUBOPs. TIH w/ret tool, latch of	g tool. onto & rel	
05/15/00: RU rig & lay lines. SICP = 130 psi, SITP = 120 psi, blow well do NDBOPs, ND tbg head, NU new 11" 3M x 7 1/16" 3M tbg head w/3 1/8" RBP. Blow well down, TOOH laying down w/RBP. Pooh laying down w/1 05/16/00: SICP = 820 psi, blow well down. Tally in w/108 new jts 2 7/8" NUWH, pump out plug w/25 bbls prod wtr. Turn well to production, release	give pert nent dates, including estimated date of statement own. NDWH, NUBOPs, unseat donut. 2m csg valves, pres test tbg head to 15.07 jts 2 3/8" tbg. SWIFN tbg, tag: PBTD @ 3404'. Land tbg in lase rig	TIH & set 7' 00 psi –ok- 1	kd work) SEE RULE 1103. " RBP @ 180', TOOH w/settin NUBOPs. TIH w/ret tool, latch of	g tool. onto & rel	
05/15/00: RU rig & lay lines. SICP = 130 psi, SITP = 120 psi, blow well do NDBOPs, ND tbg head, NU new 11" 3M x 7 1/16" 3M tbg head w/3 1/8" RBP. Blow well down, TOOH laying down w/RBP. Pooh laying down w/1 05/16/00: SICP = 820 psi, blow well down. Tally in w/108 new jts 2 7/8"	give pert nent dates, including estimated date of state own. NDWH, NUBOPs, unseat donut. 2m csg valves, pres test tbg head to 15.07 jts 2 3/8" tbg. SWIFN tbg, tag PBTD @ 3404'. Land tbg in lase rig	TIH & set 7' 00 psi –ok- 1	ed work) SEE RULE 1103.  "RBP @ 180', TOOH w/settin NUBOPs. TIH w/ret tool, latch of the wide with the wide wide with the wide with the wide w	g tool. onto & rel	
05/15/00: RU rig & lay lines. SICP = 130 psi, SITP = 120 psi, blow well de NDBOPs, ND tbg head, NU new 11" 3M x 7 1/16" 3M tbg head w/3 1/8" RBP. Blow well down, TOOH laying down w/RBP. Pooh laying down w/1 05/16/00: SICP = 820 psi, blow well down. Tally in w/108 new jts 2 7/8" NUWH, pump out plug w/25 bbls prod wtr. Turn well to production, release thereby certify that the information above is true and complete to the best of my knowledge and be a complete to the best of my kn	give pert nent dates, including estimated date of state own. NDWH, NUBOPs, unseat donut. 2m csg valves, pres test tbg head to 15.07 jts 2 3/8" tbg. SWIFN tbg, tag PBTD @ 3404'. Land tbg in lase rig	TIH & set 7' 00 psi -ok- N	ed work) SEE RULE 1103.  "RBP @ 180', TOOH w/settin NUBOPs. TIH w/ret tool, latch of the wide with the wide wide with the wide with the wide w	g tool. onto & rel	
O5/15/00: RU rig & lay lines. SICP = 130 psi, SITP = 120 psi, blow well do NDBOPs, ND tbg head, NU new 11" 3M x 7 1/16" 3M tbg head w/3 1/8" RBP. Blow well down, TOOH laying down w/RBP. Pooh laying down w/1 O5/16/00: SICP = 820 psi, blow well down. Tally in w/108 new jts 2 7/8" NUWH, pump out plug w/25 bbls prod wtr. Turn well to production, release the rest of my knowledge and be SIGNATURE.  TITLE Production	give pert nent dates, including estimated date of state own. NDWH, NUBOPs, unseat donut. 2m csg valves, pres test tbg head to 15.07 jts 2 3/8" tbg. SWIFN tbg, tag PBTD @ 3404'. Land tbg in lase rig	TIH & set 7' 00 psi -ok- N ianger @ 337	rd work) SEE RULE 1103.  "RBP @ 180', TOOH w/settin NUBOPs. TIH w/ret tool, latch of 1/5' kb w/106 jts 2 7/8" tbg. NE	g tool. onto & rel o BOP's,	