

DIVISION APPROVED PLUGGING PROGRAM

EL-MY-RI Oil Co.  
Martin #3 J-34-30N-11W

Downhole Equipment  
8 5/8" at 100' with 25 sacks  
4 1/2" at 1350' with 175 sacks

1. Go in hole with bit and drill out 10 sack cement plug (130') at 800'.
2. Clean out hole to TD 1350'.
3. Set a cement plug inside casing 1350' - 950' to cover Fruitland and Farmington. WOC a minimum of three hours. Go in hole with tubing and tag plug. If cement is above 1000' go to step 4, if not fill to 950'.
4. Find free point and shoot and pull casing, or perforate above free point.
5. If casing is pulled, set a cement plug from casing stub to cover Ojo Alamo. If casing is perforated, set a cement plug in and outside casing from perms to 600'.
6. Set a cement plug 150' - 50' below and inside surface pipe.
7. Set top plug and dryhole marker with a minimum of 10 sacks of cement.
8. Fill pits, clean and level location. All plugs will be with neat cement with or without an accelerator. Blowout prevention equipment will be required.

