

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-verse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER		5. LEASE DESIGNATION AND SERIAL NO. NM 0206995
2. NAME OF OPERATOR Ladd Petroleum Corporation		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR 830 Denver Club Bldg. Denver, CO 80202		7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface NE 1/4 NW/4 Sec 35 - T30N - R14W 1850' FWL 790' FNL		8. FARM OR LEASE NAME Aztec
14. PERMIT NO.		9. WELL NO. 1-X
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 5584 GL.		10. FIELD AND POOL, OR WILDCAT Wildcat
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 35 - T30N - R14W
		12. COUNTY OR PARISH San Juan
		13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☒

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. MI & RU service rig.
2. Spot 50 sx cement plug across Dakota Zone (TD - 5600').
3. PU & spot 50 sx. cement plug from \pm 1350 - 800'. Tag TOC & record.
4. POOH. Set cement plug in surface pipe unless well has been "Bradenhead" squeezed.
5. Cut off casing head and set regulation dry hole marker in adequate cement.
6. Clean up location.

18. I hereby certify that the foregoing is true and correct

SIGNED

William K. Sims

TITLE

Production Engineer

DATE

2/25/81

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

APPROVED

MAR 24 1981

James F. Sims
JAMES F. SIMS
DISTRICT OIL & GAS SUPERVISOR

*See Instructions on Reverse Side

NMOCC

P. O. Box 959
Farmington, New Mexico 87401

March 24, 1981

Ladd Petroleum Corporation
830 Denver Club Building
Denver, Colorado 80202

Gentlemen:

On February 27, 1981 this office received your notice of intent to abandon well No. 1-X Aztec, located in NE $\frac{1}{4}$ NW $\frac{1}{4}$ sec. 35, T. 30 N., R. 14 W., San Juan County, New Mexico on Federal lease number New Mexico 0206995. The following additions to your notice of intent to abandon are required:

1. Perforate 4 $\frac{1}{2}$ " casing at 4986' and place cement plug inside and outside casing to 4886'.
2. Perforate 4 $\frac{1}{2}$ " casing at 3664' and place cement plug inside and outside casing to 3564'.
3. Perforate 4 $\frac{1}{2}$ " casing at 2810' and place cement plug inside and outside casing to 2710'.
4. Perforate 4 $\frac{1}{2}$ " casing at 1417' and place cement plug inside and outside casing to 1317'.
5. Perforate 4 $\frac{1}{2}$ " casing at 700' and place cement plug inside and outside casing to 600'.
6. Perforate 4 $\frac{1}{2}$ " casing at 260' and place cement plug inside and outside casing to 160'.
7. Place 10' cement plug inside casing at surface.

Sincerely yours,

James F. Sims
District Oil and Gas Supervisor

cc: ✓ Well file
Chronological file
✓ NMOCC

RBell:clp

