7orm 3160-5	UNITED ST	Bu	Form approved. Budget Bureau No. 1004-0135 Expires August 31, 1985			
November 1983) Formerly 9-331)	5. LEASI	5. LEASE DESIGNATION AND SHELL NO. SF-080005				
SUNDS (Do not use this for	BUREAU OF LAND RY NOTICES AND for proposals to drill or to "APPLICATION FOR PER	REPORTS O	N WELLS the to a different reservoir.	6. IF IM	DIAN, ALLOTTE	E OR TRIBE NAME
1.	7. UMER	7. UNIT AGREEMENT NAME				
WELL WELL X	OTESE				OR LRASE WAI	ME
Tenneco Oil Com		Florance				
. ADDRESS OF OPERATOR	- 1 00 00	115		56		
P.O. Box 3249, Location of well (Repo See also space 17 below.) At surface	rt location clearly and in acc	0155 Fordance with any 8	tate requirements.*	Blan		red Cliffs
900' FSL, 790'	Sec.	Sec. 23, T30N, R9W				
14. PERMIT NO.	15. BLEVATIONS 6106	S GRARMINGTO	TAND MARAGEMENT		Juan	NM
16.	Check Appropriate Box	k To Indicate No	ature of Notice, Report,	or Other Da		
TEST WATER SHUT-OFF PRACTURE TREAT SHOOT OR ACIDIZE	PULL OR ALTER OF MULTIPLE COMPIL ABANDON®		WATER SHUT-OFF FRACTURE TREATMENT SHOOTING OR ACIDISING (Other)		empairing Altering (Abandonme	CABING
REPAIR WELL (Other)	(HANGE FEATS		(Note: Report r Completion or Re	esults of multipecompletion Rep	ple completion ort and Log fo	on Well orm.)
Tenneco reques	ts permission to led procedure.] [] [] 1 8 1984	
SIGNED (This space for Federa APPROVED BY CONDITIONS OF APP			nior Production A		DATE	10/84
				Þ	APR 17 1	984
		*See Instructions	on Reverse Side	1.4	MHIENT	BACH

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

M. MILLENBACH

1030

			LEASE		rance		
			WELL NO.	56			
8-5/8	,00,_	24	LB,_	J-55	_CSG.W/_	80	_sx
TOC @_	surf	ace					
3-1/2	"OD,_	7.7	LB,	J-55	_csg.w/_	480	_sx
TOC @		926'					

DETAILED PROCEDURE:

- 1. MIRUSU. NDWH. NUBOP.
- 2. Release pkr and RIH to PBTD. POOH.
- 3. Set WL set Baker 3-1/2" Model F pkr w/expendable plug @ +/- 2775'. Dump 2 sxs sand on pkr.
- RIH w/1-1/4" tbg & pkr. Set pkr just above Model 'F' & PT pkr to 2000 psi.
- 5. Isolate leak(s) in 3-1/2" csg. POOH w/tbg & pkr.
- Squeeze leak dn csg w/50 sxs Class 'B' cmt w/2% CaCl₂ & 6-1/4#/sx gilsonite.
- 7. If no squeeze pressure obtained, overdisplace cmt by 5 bbls & resqueeze.
- B. RIH w/tbg, 2" drill collars, csg scraper & bit. DO cmt. RIH to Model 'F' & PT squeeze to 500 psi. Circ hole clean w/2% KCl wtr.
- 9. POOH w/tbg & bit. RIH w/tbg & half muleshoe prod. tube. baload bole a/Hz, clean sd off pkr.
- 10. Knock plug out of Model 'F'. LAND T&G
 IN PKR.
- 11. NDBOP. NUWH.
- 12. RDMOSU.

12 +69 Baker (-1 Pkr @ 2780 2839 PC 22 HARS 2874