

Brimhall #1

Shut in well, ND BOP and cut well head off. Install dry hole marker with 10 sx of cement and rig down.

Cementing summary:

- Plug #1 from 4376' to 3848' with 40 sx Class "B" cement.
- Plug #2 from 3113' to 2915' with 15 sx Class "B" cement
- Plug #3 from 1655' to 1457' with 15 sx of Class "B" cement
- Plug #4 from 266' to surface with 86 sx of Class "B" cement; circulate 1 bbl. good cement out bradenhead.