UNITED STATES

DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

Sundry N	otices and Reports on Well:	s 	
		5.	Lease Number
			NM-0607
		6.	If Indian, All. or
Type of Well			Tribe Name
GAS	16 Th T	18 10	
	7/2/2/0	7.	Unit Agreement Name
	1	(d (2)	•
Name of Operator	A A	♦ •• `cd]	
BURLINGTON	(a) (c)	5000 =	
RESOURCES 0	LL & GAS COMPANY (5)	(00) 8. (00) 8.	
	<u> </u>	on 3 8.	Well Name & Number
Address & Phone No. of Ope	rator	57.4	Atlantic C #1
PO Box 4289, Farmington,	NM 87499 (505) 326-2700	9.	API Well No.
		1 Alexander	30-045-10075 . Field and Pool
Location of Well, Footage,	Sec., T, R, M		Blanco Mesaverde
1650'FSL, 990'FWL, Sec.35,	T-31-N, R-10-W, NMPM	11	. County and State
		**	San Juan Co, NM
CURCU ADDRODDIATE DOV TO	INDICATE NATURE OF NOTICE,	REPORT, OTHE	R DATA
. CHECK APPROPRIATE BOX TO	Type of Act	ion	
Type of Submission Notice of Intent		Change of P	lans
Notice of intent		New Constru	ction
y Subsequent Report		Non-Routine	
X Subsequent Report	Plugging Back Casing Repair	Water Shut	off
	Plugging Back Casing Repair	Water Shut	off
X Subsequent Report Final Abandonment	Plugging Back Casing Repair Altering Casing	Water Shut Conversion	off
	Plugging Back Casing Repair	Water Shut Conversion	off
Final Abandonment	Plugging Back Casing Repair Altering Casing X Other - Tubing & C	Water Shut Conversion	off
Final Abandonment Describe Proposed or C	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations	Water Shut Conversion csg repair	off to Injection
Final Abandonment Describe Proposed or C 3-27-00 MIRU. ND WH.	Plugging Back Casing Repair Altering Casing X Other - Tubing & Completed Operations NU BOP. Attempt to PT tbg.	Water Shut Conversion csg repair	off to Injection
Final Abandonment B. Describe Proposed or C 3-27-00 MIRU. ND WH.	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations NU BOP. Attempt to PT tbg.	Water Shut Conversion csg repair Tbg & csg par	off to Injection ted. TOOH w/2 3/8" the
Final Abandonment Describe Proposed or C 3-27-00 MIRU. ND WH. TIH w/fish	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON.	Water Shut Conversion csg repair Tbg & csg par	off to Injection ted. TOOH w/2 3/8" then the state of th
Final Abandonment Describe Proposed or C 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal appro	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM,	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg)	off to Injection ted. TOOH w/2 3/8" to Fish for parted 2 3 3/8" tbg. SDON.
Final Abandonment Describe Proposed or C 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal approtbg. Latch	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis.	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2	off to Injection ted. TOOH w/2 3/8" the for parted 2 3 3/8" the SDON. OK. Spot 2 sx snd on
Final Abandonment Describe Proposed or C 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal approtbg. Latch 3-29-00 TIH w/RBP, se	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2 psi/15 min, 0	off to Injection ted. TOOH w/2 3/8" the state of the sta
Final Abandonment Describe Proposed or C 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal approtbg. Latch 3-29-00 TIH w/RBP, se RBP. TOOH.	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2 psi/15 min, 0 TIH w/fishir	off to Injection ted. TOOH w/2 3/8" the state of the sta
Final Abandonment 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal approtbg. Latch 3-29-00 TIH w/RBP, se RBP. TOOH. csg. Back	Plugging Back Casing Repair Altering Casing X Other - Tubing & Completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP off 4 %" csg @ 133'. TOOH J-55 LT&C csg. Screw 4 %"	Water Shut Conversion Sig repair The a csg par to PT 7" csg) hing tools a 2 psi/15 min, 0 TH w/fishir w/4 %" csg a f	off to Injection ted. TOOH w/2 3/8" the Fish for parted 2 3 3/8" the SDON. OK. Spot 2 sx snd on and tools. Fish onto 4 the Spot 2 sx snd on the Spot 3 sx
Final Abandonment 3. Describe Proposed or C 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal approtbg. Latch 3-29-00 TIH w/RBP, se RBP. TOOH. csg. Back 4 %" 10.5#	Plugging Back Casing Repair Altering Casing X Other - Tubing & Completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP off 4 %" csg @ 133'. TOOH J-55 LT&C csg. Screw 4 %"	Water Shut Conversion Sig repair The a csg par to PT 7" csg) hing tools a 2 psi/15 min, 0 TH w/fishir w/4 %" csg a f csg together a 620'. Rls Ri	off to Injection ted. TOOH w/2 3/8" ti Fish for parted 2 3 3/8" tbg. SDON. OK. Spot 2 sx snd on ag tools. Fish onto 4 Fishing tools. TIH w/ ND BOP. PT 4 %" csg BP. SDON.
Final Abandonment 3. Describe Proposed or C 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal approty tbg. Latch 3-29-00 TIH w/RBP, se RBP. TOOH. csg. Back 4 ½" 10.5# 500 psi, C 3-30-00 Reset RBP @ 3	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP off 4 %" csg @ 133'. TOOH J-55 LT&C csg. Screw 4 %" K. NU BOP. TIH, CO to RBP 850'. PT csg to 500 psi/15	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2 psi/15 min, 0 TIH w/fishir w/4 %" csg & f csg together @ 620'. Rls RI min, OK. Rls ll. SDON.	off to Injection ted. TOOH w/2 3/8" the fish for parted 2 3 3/8" the SDON. OK. Spot 2 sx snd on the spot 2 sx snd on the spot 2 sx snd on the spot 3 sylvent and 5 spot 2 sx snd on the spot 3 sylvent and 5 sylvent and
Final Abandonment 3. Describe Proposed or C 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal approty tbg. Latch 3-29-00 TIH w/RBP, se RBP. TOOH. csg. Back 4 ½" 10.5# 500 psi, C 3-30-00 Reset RBP @ 3	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP off 4 %" csg @ 133'. TOOH J-55 LT&C csg. Screw 4 %" K. NU BOP. TIH, CO to RBP 850'. PT csg to 500 psi/15	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2 psi/15 min, 0 TIH w/fishir w/4 %" csg & f csg together @ 620'. Rls RI min, OK. Rls ll. SDON.	off to Injection ted. TOOH w/2 3/8" the fish for parted 2 3 3/8" the SDON. OK. Spot 2 sx snd on the spot 2 sx snd on the spot 2 sx snd on the spot 3 sylvent and 5 spot 2 sx snd on the spot 3 sylvent and 5 sylvent and
Final Abandonment 3. Describe Proposed or C 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal approteg. Latch 3-29-00 TIH w/RBP, se RBP. TOOH. csg. Back 4 ½" 10.5# 500 psi, C 3-30-00 Reset RBP @ 3 @ 5705'. C 3-31-00 Tag up @ 5740	Plugging Back Casing Repair Altering Casing X Other - Tubing & Completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP off 4 %" csg @ 133'. TOOH J-55 LT&C csg. Screw 4 %" K. NU BOP. TIH, CO to RBP 850'. PT csg to 500 psi/15 O to PBTD @ 5767'. Blow we	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2 psi/15 min, 0 TIH w/fishir w/4 %" csg & f csg together @ 620'. Rls RI min, OK. Rls ll. SDON.	off to Injection ted. TOOH w/2 3/8" the fish for parted 2 3 3/8" the SDON. OK. Spot 2 sx snd on the spot 2 sx snd on the spot 2 sx snd on the spot 3 sylvent and 5 spot 2 sx snd on the spot 3 sylvent and 5 sylvent and
Final Abandonment 3. Describe Proposed or C 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal approteg. Latch 3-29-00 TIH w/RBP, se RBP. TOOH. csg. Back 4 ½" 10.5# 500 psi, C 3-30-00 Reset RBP @ 3 @ 5705'. C 3-31-00 Tag up @ 5740	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP off 4 %" csg @ 133'. TOOH J-55 LT&C csg. Screw 4 %" K. NU BOP. TIH, CO to RBP 850'. PT csg to 500 psi/15	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2 psi/15 min, 0 TIH w/fishir w/4 %" csg & f csg together @ 620'. Rls RI min, OK. Rls ll. SDON.	off to Injection ted. TOOH w/2 3/8" the fish for parted 2 3 3/8" the SDON. OK. Spot 2 sx snd on the spot 2 sx snd on the spot 2 sx snd on the spot 3 sylvent and 5 spot 2 sx snd on the spot 3 sylvent and 5 sylvent and
Final Abandonment 3. Describe Proposed or C 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal approteg. Latch 3-29-00 TIH w/RBP, se RBP. TOOH. csg. Back 4 ½" 10.5# 500 psi, C 3-30-00 Reset RBP @ 3 @ 5705'. C 3-31-00 Tag up @ 5740	Plugging Back Casing Repair Altering Casing X Other - Tubing & Completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP off 4 %" csg @ 133'. TOOH J-55 LT&C csg. Screw 4 %" K. NU BOP. TIH, CO to RBP 850'. PT csg to 500 psi/15 O to PBTD @ 5767'. Blow we	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2 psi/15 min, 0 TIH w/fishir w/4 %" csg & f csg together @ 620'. Rls RI min, OK. Rls ll. SDON.	off to Injection ted. TOOH w/2 3/8" the fish for parted 2 3 3/8" the SDON. OK. Spot 2 sx snd on the spot 2 sx snd on the spot 2 sx snd on the spot 3 sylvent and 5 spot 2 sx snd on the spot 3 sylvent and 5 sylvent and
Final Abandonment 3. Describe Proposed or C 3-27-00 MIRU. ND WH.	Plugging Back Casing Repair Altering Casing X Other - Tubing & Completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP off 4 %" csg @ 133'. TOOH J-55 LT&C csg. Screw 4 %" K. NU BOP. TIH, CO to RBP 850'. PT csg to 500 psi/15 CO to PBTD @ 5767'. Blow we by CO to PBTD @ 5767'. Land WH. RD. Rig released.	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2 psi/15 min, 0 TIH w/fishir w/4 %" csg & f csg together @ 620'. Rls RI min, OK. Rls ll. SDON. d 183 jts 2 3	off to Injection ted. TOOH w/2 3/8" the fish for parted 2 3 3/8" the SDON. OK. Spot 2 sx snd on the spot 2 sx snd on the spot 2 sx snd on the spot 3 sylvent and 5 spot 2 sx snd on the spot 3 sylvent and 5 sylvent and
Final Abandonment 3. Describe Proposed or C 3-27-00 MIRU. ND WH.	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP off 4 %" csg @ 133'. TOOH J-55 LT&C csg. Screw 4 %" K. NU BOP. TIH, CO to RBP 850'. PT csg to 500 psi/15 CO to PBTD @ 5767'. Blow we by CO to PBTD @ 5767'. Land WH. RD. Rig released.	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2 psi/15 min, 0 TIH w/fishir w/4 ½" csg & 1 csg together @ 620'. Rls RI min, OK. Rls ll. SDON. d 183 jts 2 3,	off to Injection ted. TOOH w/2 3/8" the standard standar
Final Abandonment 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal approtog. Latch 3-29-00 TIH w/RBP, se RBP. TOOH. csg. Back 4 ½" 10.5# 500 psi, C 3-30-00 Reset RBP @ 3 @ 5705'. C 3-31-00 Tag up @ 5740 ND BOP. NO	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP off 4 %" csg @ 133'. TOOH J-55 LT&C csg. Screw 4 %" K. NU BOP. TIH, CO to RBP 850'. PT csg to 500 psi/15 CO to PBTD @ 5767'. Blow we by CO to PBTD @ 5767'. Land WH. RD. Rig released.	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2 psi/15 min, 0 TIH w/fishir w/4 ½" csg & 1 csg together @ 620'. Rls RI min, OK. Rls ll. SDON. d 183 jts 2 3,	off to Injection ted. TOOH w/2 3/8" the standard standar
Final Abandonment 3. Describe Proposed or C 3-27-00 MIRU. ND WH.	Plugging Back Casing Repair Altering Casing X Other - Tubing & Completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP off 4 %" csg @ 133'. TOOH J-55 LT&C csg. Screw 4 %" K. NU BOP. TIH, CO to RBP 850'. PT csg to 500 psi/15 CO to PBTD @ 5767'. Blow we by CO to PBTD @ 5767'. Land WH. RD. Rig released.	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2 psi/15 min, 0 TIH w/fishir w/4 ½" csg & 1 csg together @ 620'. Rls RI min, OK. Rls ll. SDON. d 183 jts 2 3,	off to Injection ted. TOOH w/2 3/8" the standard standar
Final Abandonment 3. Describe Proposed or C 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal approty tbg. Latch 3-29-00 TIH w/RBP, se RBP. TOOH. csg. Back 4 ½" 10.5# 500 psi, C 3-30-00 Reset RBP @ 3 @ 5705'. C 3-31-00 Tag up @ 5740 ND BOP. NU	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP off 4 %" csg @ 133'. TOOH J-55 LT&C csg. Screw 4 %" K. NU BOP. TIH, CO to RBP 850'. PT csg to 500 psi/15 O to PBTD @ 5767'. Blow we off the foregoing is true and Title Regulatory Additional Complete	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2 psi/15 min, 0 TIH w/fishir w/4 ½" csg & 1 csg together @ 620'. Rls RI min, OK. Rls ll. SDON. d 183 jts 2 3,	off to Injection ted. TOOH w/2 3/8" the for parted 2 3 3/8" the SDON. OK. Spot 2 sx snd on a tools. Fish onto 4 tishing tools. TIH w/1 ND BOP. PT 4 ½" csg BP. SDON. RBP & TOOH. TIH, tag 1/8" 4.7# J-55 the 9 5
Final Abandonment 3-27-00 MIRU. ND WH. TIH w/fish 3-28-00 (Verbal approtog. Latch 3-29-00 TIH w/RBP, se RBP. TOOH. csg. Back 4 ½" 10.5# 500 psi, C 3-30-00 Reset RBP @ 3 @ 5705'. C 3-31-00 Tag up @ 5740 ND BOP. NO	Plugging Back Casing Repair Altering Casing X Other - Tubing & completed Operations NU BOP. Attempt to PT tbg. ing tools. SDON. val from Steve Mason, BLM, ed onto collar. TOOH w/fis. t @ 620'. PT 7" csg to 500 ND BOP. Repair WH. NU BOP off 4 %" csg @ 133'. TOOH J-55 LT&C csg. Screw 4 %" K. NU BOP. TIH, CO to RBP 850'. PT csg to 500 psi/15 O to PBTD @ 5767'. Blow we off the foregoing is true and Title Regulatory Additional Complete	Water Shut Conversion csg repair Tbg & csg par to PT 7" csg) hing tools & 2 psi/15 min, 0 TIH w/fishir w/4 ½" csg & 1 csg together @ 620'. Rls RI min, OK. Rls ll. SDON. d 183 jts 2 3,	off to Injection ted. TOOH w/2 3/8" the for parted 2 3 3/8" the SDON. OK. Spot 2 sx snd on a tools. Fish onto 4 tishing tools. TIH w/1 ND BOP. PT 4 ½" csg BP. SDON. RBP & TOOH. TIH, tag 1/8" 4.7# J-55 the 9 5

TO THE PERSON SHAWE