

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

5. LEASE DESIGNATION AND SERIAL NO.

WR 594 NM-03187

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

LAMBE

9. WELL NO.

2

10. FIELD AND POOL, OR WILDCAT

Blanco Mesa Verde (Gas)

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

20-31N-10W

1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Koch Exploration Company

3. ADDRESS OF OPERATOR

P.O. Box 2256, Wichita, Kansas 67201

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

NE NE

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6088 DF

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

Recommended Procedure

1. Move in & rig up pulling unit, install BOP.
2. Pull 2-7/8" tbg. (set @ 4365').
3. Run 6-1/4" bit to approx. 4000' (top good cmt 3100').
4. If 6-1/4" bit will not go through bad casing, run 6" csg. swage (swage for 7" 23# csg.).
5. Run 7" 23# Hal R-4 pkr. & set approx. 4350'.
6. Swab well in & put on prod.

Note: Halliburton R-4 7" pkr max. O.D. 5.75".

18. I hereby certify that the foregoing is true and correct

SIGNED

Orwell L. Schmidt

TITLE Operations Manager

DATE 11-26-74

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE