#### UNITED STATES

# DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

		5.	Lease Number
		5.	SF-078507
1. Type of Well GAS  2. Name of Operator		6.	If Indian, All. or Tribe Name
	<del></del>	7.	Unit Agreement Name San Juan 32-9 Unit
. Name of Operator			San Cuan 52-5 Chiz
RESOURCES	& GAS COMPANY	- , %	
	AND COMPANY	-8:	Well Name & Number
3. Address & Phone No. of Opera	tor	를 불	San Juan 32-9 U#3
PO Box 4289, Farmington, NM	87499 (505) 326-9700	9.	<b>API Well No.</b> 30-045-22899
4. Location of Well, Footage, Sec., T, R, M		10.	Field and Pool
1815'FSL 1450'FEL, Sec.1, T-			Blanco Mesaverde
		11.	County and State San Juan Co, NM
12. CHECK APPROPRIATE BOX TO IN		ORT, OTHER	DATA
Type of Submission	Type of Action Abandonment Cha	ange of Pla	anc
_X_ Notice of Intent		w Construct	
	recompression		
Subsequent Report			
Subsequent Report	Plugging Back Nor	n-Routine : ter Shut o	Fracturing
Subsequent Report Final Abandonment	Plugging Back Nor	n-Routine : ter Shut o	Fracturing ff
	Plugging Back Nor Casing Repair Wat	n-Routine : ter Shut o	Fracturing ff
Final Abandonment	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine : ter Shut o	Fracturing ff
Final Abandonment	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine : ter Shut o	Fracturing ff
Final Abandonment	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine : ter Shut o	Fracturing ff
Final Abandonment  Describe Proposed or Comp.	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine : ter Shut o nversion to	Fracturing  ff  o Injection
Final Abandonment  Describe Proposed or Comp  It is intended to install	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine : ter Shut o nversion to	Fracturing  ff o Injection  to the attached
Final Abandonment  Describe Proposed or Comp  It is intended to install	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine : ter Shut o nversion to	Fracturing  ff  o Injection
Final Abandonment  Describe Proposed or Comp  It is intended to install	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine : ter Shut o nversion to	Fracturing  ff o Injection  to the attached
Final Abandonment  Describe Proposed or Comp  It is intended to install	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine : ter Shut o nversion to	Fracturing  ff o Injection  to the attached
Final Abandonment  Describe Proposed or Comp  It is intended to install	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine : ter Shut o nversion to	Fracturing  ff o Injection  to the attached
Final Abandonment  Describe Proposed or Comp  It is intended to install	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine : ter Shut o nversion to	Fracturing  ff o Injection  to the attached
Final Abandonment  Describe Proposed or Comp  It is intended to install	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine : ter Shut o nversion to	Fracturing  ff o Injection  to the attached
Final Abandonment  Describe Proposed or Comp  It is intended to install	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine : ter Shut o nversion to	Fracturing  ff o Injection  to the attached
Final Abandonment  13. Describe Proposed or Comp  It is intended to install	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine : ter Shut o nversion to	Fracturing  ff o Injection  to the attached
Final Abandonment  13. Describe Proposed or Comp.  It is intended to install procedure.	Plugging Back Nor Casing Repair Wate Altering Casing Cor X Other -  leted Operations  a pump in the subject well a	n-Routine iter Shut on the shut of the shu	Fracturing  ff o Injection  to the attached
Final Abandonment  13. Describe Proposed or Comp  It is intended to install procedure.	Plugging Back Nor Casing Repair Wat Altering Casing Cor X Other -	n-Routine iter Shut on the shut of the shu	Fracturing  ff o Injection  to the attached
Final Abandonment  13. Describe Proposed or Comp  It is intended to install procedure.	Plugging Back Nor Casing Repair Wate Altering Casing Cor X Other -  leted Operations  a pump in the subject well a	n-Routine iter Shut on the shut of the shu	Fracturing  ff o Injection  to the attached
Final Abandonment  13. Describe Proposed or Comp  It is intended to install procedure.  14. I hereby certify that the Signed Man hered	Plugging Back Nor Casing Repair Wate Altering Casing Cor X Other -  leted Operations  a pump in the subject well a foregoing is true and correct MEL4) Title Regulatory Admits	n-Routine iter Shut on nversion to according	Fracturing  ff o Injection  to the attached
Final Abandonment  13. Describe Proposed or Comp  It is intended to install procedure.	Plugging Back Nor Casing Repair Wate Altering Casing Cor X Other -  leted Operations  a pump in the subject well a pump in the subject well a foregoing is true and correct (MEL4) Title Regulatory Administrations  e Office use	n-Routine iter Shut on nversion to according	Fracturing  ff o Injection  to the attached

#### San Juan 32-9 Unit #3A

### Mesaverde

#### 1815'FSL, 1450' FEL

Unit J, Section 1, T-31-N, R-10-W

Latitude / Longitude: 36° 55.4846' / 107° 49.8962' DPNO: 6997001

## Rod Pump Installation Procedure

- 1. Install used C-160 pumping unit.
- 2. Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Prior to moving in rig, make one-call and then verify rig anchors and dig pit.
- 3. MOL and RU workover rig. Obtain and record all wellhead pressures. NU relief line. Blow well down and kill with 2% KCL water if necessary. ND WH and NU BOP with stripping head. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary.
- Mesaverde, 2-3/8", 4.7# J-55 tubing is set at 5995'. Broach tubing and set tubing plug in tubing 4. at 5940'. Fill tubing with half of its volume of 2% KCL to insure the tubing plug will be held in place. Release donut; pick up additional joints of tubing and tag bottom. (Record depth). TOOH with tubing. PBTD should be at  $\pm 6050$ . Visually inspect tubing for corrosion and replace any bad joints. Remove any unnecessary equipment (i.e. Tbg stop, bumper spring, etc.). Check tubing for scale build up and notify Operations Engineer.
- 5. PU and TIH with 3-7/8" bit, bit sub and watermelon mill on 2-3/8" tubing and round trip to below perforations, cleaning out with air/mist. NOTE: When using air/mist, minimum mist rate is 12 bph. If scale is present, contact Operations Engineer to determine methodology for removing scale from easing and perforations.
- 6. Rabbit all tubing prior to TIH. TIH with one joint of 2-3/8" 4.7# tubing, 4' perforated sub, inline check, 1.78" seating nipple, and then remaining 2-3/8" tubing. Replace any bad joints.
- 7. Land tubing at ±6035'. NOTE: If excessive fill is encountered, discuss this landing depth with Operations Engineer. Pump off check valve. ND BOP and NU WH.
- 8. If fill was encountered, contact Operations Engineer to discuss possibility of running a sand screen on the pump. PU and TIH with 2" x 1.25" x 10' x 14' RHAC-Z insert pump, from Energy Pump & Supply, 1 1-1/4" sinker bar (5/8" pin with 3/4" crossover), 3/4" Grade D rods with spraymetal couplings to 2766', and molded paraffin scrapers to surface. Test pump action and hang rods on pumping unit. RD and MOL. Return well to production.

Recommended: M.F. Kutur Operations Engineer

Approved:

Bruce D. Dony 1-26-99 Drilling Superintendent

Operations Engineer:

Mary Ellen Lutey

Pump and Rods:

Energy Pump & Supply

Office - (599-4052) Leo Noves Home - (325-9387)

Office - (564-2874)

Pager - (324-2671)