UNITED STATES

DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT



	Sundry Notices and Reports 9	P JULY 29 PH 3:1	06	
. Type of Well	0	70 FARMINGTON, A	5. M 6.	Lease Number SF-078507 If Indian, All. or Tribe Name
3.2			7.	Unit Agreement Name
. Name of Operator			7.	San Juan 32-9 Unit
BURLING				
RESOURC	OIL & GAS COMPANY		_	Well Name & Number
	V. of Operator		8.	San Juan 32-9 U#3A
. Address & Phone PO Box 4289, Fa	rmington, NM 87499 (505) 326	-9700	9.	
. Location of Well 1815'FSL 1450'FE	., Footage, Sec., T, R, M L, Sec.1, T-31-N, R-10-W, NMP	 M		Field and Pool Blanco Mesaverde County and State San Juan Co, NM
2 CHECK APPROPRIA	TE BOX TO INDICATE NATURE OF	NOTICE, REPORT,	OTHER	DATA
	pandonment Altering Ca _X_ Other - pum	asing Conver mp installation		
3. Describe Prop	posed or Completed Operations			
7-13-99 MIF 7-14-99 ND	RU. SDON. WH. NU BOP. TIH, tag up @ 601 240'. ND BOP. ND WH. NU new	WH, test secon	dary s	eal, OK. 100f w/RBF.
7-13-99 MIF 7-14-99 ND 7-15-99 TIF	RU. SDON. WH. NU BOP. TIH, tag up @ 601 240'. ND BOP. ND WH. NU new TIH, circ & CO to 6021'. TO H w/193 jts 2-3/8" 4.7# J-55 to one 2" x 1 %" x 10' x 14' How to the company of the c	w WH, test secon DOH. SDON. tbg, set @ 5995' Rhac-z pump & ro	. ND E	OP. NU WH. TIH W/
7-13-99 MIF 7-14-99 ND 7-15-99 TIF	RU. SDON. WH. NU BOP. TIH, tag up @ 601 240'. ND BOP. ND WH. NU new TIH, circ & CO to 6021'. TO	w WH, test secon DOH. SDON. tbg, set @ 5995' Rhac-z pump & ro	. ND E	OP. NU WH. TIH W/
7-13-99 MIF 7-14-99 ND 7-15-99 TIF	RU. SDON. WH. NU BOP. TIH, tag up @ 601 240'. ND BOP. ND WH. NU new TIH, circ & CO to 6021'. TO H w/193 jts 2-3/8" 4.7# J-55 to one 2" x 1 %" x 10' x 14' How to the company of the c	w WH, test secon DOH. SDON. tbg, set @ 5995' Rhac-z pump & ro	. ND E	OP. NU WH. TIH W/
7-13-99 MIF 7-14-99 ND 7-15-99 TIF	RU. SDON. WH. NU BOP. TIH, tag up @ 601 240'. ND BOP. ND WH. NU new TIH, circ & CO to 6021'. TO H w/193 jts 2-3/8" 4.7# J-55 to one 2" x 1 %" x 10' x 14' How to the company of the c	w WH, test secon DOH. SDON. tbg, set @ 5995' Rhac-z pump & ro	. ND.E	OP. NU WH. TIH W/
7-13-99 MIF 7-14-99 ND 7-15-99 TIF 7-16-99 TIF	RU. SDON. WH. NU BOP. TIH, tag up @ 601 240'. ND BOP. ND WH. NU new TIH, circ & CO to 6021'. TO H w/193 jts 2-3/8" 4.7# J-55 to one 2" x 1 1/4" x 10' x 14' for w/pump & rods. SDON. H w/pump & rods. PT & pump act	WH, test second DOH. SDON. tbg, set @ 5995' Rhac-z pump & ro	. ND.E	OP. NU WH. TIH W/ ds hung up. TOOH EGETVER AUG 0 6 1999 OIL CON. DIV.
7-13-99 MIF 7-14-99 ND 7-15-99 TIF 7-16-99 TIF	RU. SDON. WH. NU BOP. TIH, tag up @ 601 240'. ND BOP. ND WH. NU new TIH, circ & CO to 6021'. TO H w/193 jts 2-3/8" 4.7# J-55 to one 2" x 1 %" x 10' x 14' How to the company of the c	w WH, test second OOH. SDON. tbg, set @ 5995' Rhac-z pump & rottion, OK. RD. Ri	. NDe ods. Ro	OP. NU WH. TIH W/ ds hung up. TOOH AUG 0 6 1999 OIL CON. DIV. DIN. 3
7-13-99 MIF 7-14-99 ND 7-15-99 TIF 7-16-99 TIF	RU. SDON. WH. NU BOP. TIH, tag up @ 601 240'. ND BOP. ND WH. NU new TIH, circ & CO to 6021'. To H w/193 jts 2-3/8" 4.7# J-55 to one 2" x 1 ½" x 10' x 14' H w/pump & rods. SDON. H w/pump & rods. PT & pump act	w WH, test second DOH. SDON. tbg, set @ 5995' Rhac-z pump & rotation, OK. RD. Ri	. NDe ods. Ro	OP. NU WH. TIH W/ ds hung up. TOOH AUG 0 6 1999 DING 3