

**Marcotte #1A MV
Repair Procedure
O Sec 8 T31N R10W
San Juan County, New Mexico**

1. Comply with all NMOCD, BLM, & MOI rules and regulations. Test rig anchors & MI blow pit. MOL and RU completion rig (**DAYLIGHT**). NU adapter flange & BOP with flow tee and stripping head. Test operation of rams. NU blooie line and 2-7/8" relief line. Blow well down. Only if necessary, kill well w/ water.
2. TOH w/ the 2-3/8" tbg (5373' - SN @ 5342').
3. TIH w/ 7" csg scrapper on tested 2-3/8" tubing to 2000'. TOH.
4. TIH w/ 7" retrievable bridge plug on 2-3/8" tbg and set @ 2000'. Load hole. TOH. Dump 1 sx sand on RBP.
5. MI & RU Wireline truck. Run a Cement Bond log from 1950' to Surf. Apply 1000 psi if necessary to clarify bond. Pressure test csg to 1000 psi.
6. Perf 2 SQ holes in 7" csg 50' above the TOC. TIH w/ 2-3/8" tbg. and pkr. to 100' above SQ perfs. Load the backside w/ water. W/ bradenhead valve open and the pipe rams closed establish rate down 2-3/8". If circ can be established w/ bradenhead valve, circ cmt out bradenhead valve. Cmt w/ class "B" w/ 0.6% F.L. additive and 2% CaCl. Max pressure is 1000 psi. Flush cmt w/ water to leave 50' above perfs. Pull 2 stands of pipe and repressurize. Rig down cement crew and wait 4 hours. Check for flow. If there is no flow TOH. Otherwise, test every hour thereafter. If circulation was not established then run a temperature survey and squeeze 50' above TOC.
7. TIH with 6-1/4" bit on 2-3/8" tbg. Drill out cmt w/ air/mist below the squeeze holes & pressure test to 500 psi. Resqueeze if necessary. When pressure test holds, circ sand off RBP @ 2000' w/ air/mist (2% KCL). Retrieve BP. TOH. TIH w/ 3-7/8" bit on 2-3/8" tbg & C.O. to PBD 5421'. TOH.
8. Run and set 2-3/8" tbg @ 5373' w/ S.N. one joint above bottom.
9. Release rig & resume production.

Approve: _____
J. A. Howieson

VENDORS:

Wireline:	Petro-Wireline	326-6669
Cement:	BJ	327-6288