Form 3160-5 (August 1999)

## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB NO. 1004-0135 Expires: November 30, 2000

Lance Serial No

J.	Lease Sellai No.	
	NM - 000606	

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.

6. If Indian, Allottee or Tribe Name

	7	7. If Unit or CA/Agreement, Name and/or No.						
SUBMIT IN TRIPLICATE - Other instru								
Type of Well     Oil Well	8	8. Well Name and No. ATLANTIC A LS 18						
Name of Operator     BP AMERICA PRODUCTION COMPANY     Contact:	EY nl@bp.com	9	9. API Well No. 30-045-23228					
3a. Address P.O. BOX 3092 HOUSTON, TX 77253	Ph: 281.36	3b. Phone No. (include area code) Ph: 281.366,4491 Fx: 281.366,0700			10. Field and Pool, or Exploratory BLANCO PICTURED CLIFFS			
4. Location of Well (Footage, Sec., T., R., M., or Survey Descript		11. County or Parish, and State						
Sec 27 T31N R10W NESW 1500FSL 1800FWL SAN JUAN COUNTY, NM								
12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA								
TYPE OF SUBMISSION	PACTION							
☐ Acidize	☐ Dee	oen	☐ Production (Start/Resume)		☐ Water Shut-Off			
☑ Notice of Intent ☐ Alter Casing	ing		on	■ Well Integrity				
☐ Subsequent Report ☐ Casing Repair	□ New	Construction	☐ Recomplete		☐ Other			
☐ Final Abandonment Notice ☐ Change Plans	🛛 Plug	and Abandon	☐ Temporarily Abandon					
☐ Convert to Injection	n 🗖 Plug	Back	☐ Water Disposal					
Atlacting both difference of persons. If the operations is a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)  BP respectfully request permission to plug and abandon the subject well as per the following procedure:  Notify NMOCD - Charlie Perrin 505-334-6178x16 & BLM - @ 505-599-8907 24 hours prior to beginning the P&A operations.  1. Check anchors. MIRU workover rig. 2. Check and record tubing, casing, and bradenhead pressures. 3. Blow down wellhead. Kill with water if necessary. 4. Nipple down WH. NU BOPs. 5. TOH and LD 1-1/4" production tubing. 6. PU 2-3/8" workstring. 7. TIH w/4-1/2" CIBP & set @ 2950'. PU and spot 450' cement plug (40 cu ft) above CIBP from 2500'-2950' to cover Picture Cliffs and Fruitland intervals.								
14. I hereby certify that the foregoing is true and correct.  Electronic Submission #14141 verified by the BLM Well Information System  For BP AMERICA PRODUCTION COMPANY, sent to the Farmington								
Name (Printed/Typed) MARY CORLEY		Title AUTHORIZED REPRESENTATIVE						
Signature (Electronic Submission)	Date 09/10/2002							
THIS SPACE FOR FEDERAL OR STATE OFFICE USE								
Approved By Original Signed: Stephen Mason		Title		Date	9/16/02			
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.  Office								
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.								

## Additional data for EC transaction #14141 that would not fit on the form


## 32. Additional remarks, continued

1534' 1736'

8. TOH to 1650. Spot 200 cement plug (16 cu ft) across Ojo Alamo from 1450. TOH. 9. RU WL unit. RIH and perforate squeeze holes at 300. 10. Pump 175 cu ft cement down casing and circulate to surface. Leave casing full of cement. 11. ND BOPs. Cut off wellhead and install P&A marker.

## Atlantic A LS #18

Sec 27, T31N, R10W API: 30-045-23228

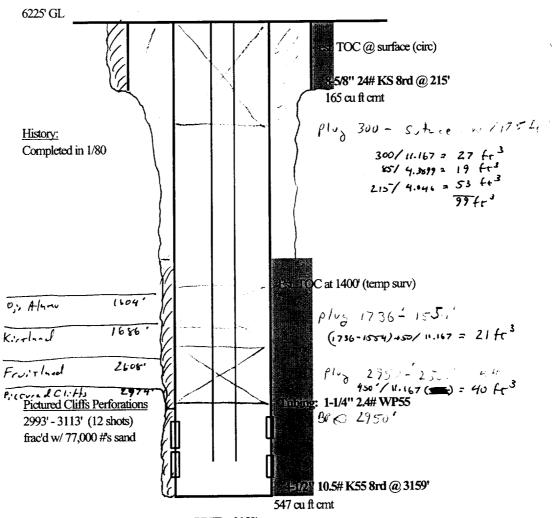

PBTD: 3159

updated: 5/29/01 jad

NOTES: