State of New Mexico Form C-103 Submit 3 Copies **Revised 1-1-89** Energy, Minerals and Natural Resources Department to Appropriate District Office OIL CONSERVATION DIVISION P.O. Box 1980, Hobbs, NM 88240 WELL API NO. P.O.Box 2088 3004524042 DISTRICT II P.O. Drawer DD, Artesia, NM 88210 Santa Fe, New Mexico 87504-2088 5. Indicate Type of Lease FEE X STATE L DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410 6. State Oil & Gas Lease No. SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) Thurston Com A 1. Type of Well: WELL OTHER 2. Name of Operator Attention: 8. Well No. Amoco Production Company Gail M. Jefferson 3. Address of Operator 9. Pool name or Wildcat (303) 830-6157 P.O. Box 800 Denver Colorado 80201 Basin Dakota 4. Well Location 790 North Unit Letter Feet From The Feet From The Line 31 31N 11W San Juan Section Township Range County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PLUG AND ABANDON ALTERING CASING PERFORM REMEDIAL WORK REMEDIAL WORK **TEMPORARILY ABANDON** CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONME PULL OR ALTER CASING CASING TEST AND CEMENT JOB OTHER: OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. Amoco Production Company requests permission to plug and abandon the above referenced well per the attached procedures. If you have any technical questions please contact Carolanne Wyett at (303) 830-5578 or Gail Jefferson for any administrative concerns. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

TYPE OR PRINT NAME

| Continue |

(This space for State Use)

PPROVED BY Johnny Rollinson

DEPUTY OIL & GAS INSPECTOR, DIST. #3

JUL 2 3 1998

conditions of Approval, IF ANY. A Notify OCD in time to witness Thurston Com A #1
Orig. Comp. 5/80
TD = 6985, PBTD = 6965
Page 2 of 2

- 1. Check location for anchors. Install if necessary. Test anchors.
- 2. MIRUSU. Blow down well. Kill if necessary with fresh water. NDWH. NUBOP.
- 3. POOH with 2 3/8" tbg. Run in hole with tbg and CIBP, set CIBP at 6675'. (Above the pkr at 6840') Test csg integrity to 500#. Spot 100' cement plug on top. (13 cuft cement) Pull up hole and spot 100' cement plug at 5820' to 5920' GP, 3900' to 4000' MV, 2380' to 2480 PC, 720' to 820' OJ, and 307 to surface with 68 cuft cement.
- 4. NDBOP. Cut off casing and wellhead. Install PXA marker according to BLM or State requirements.
- 5. Contact FMC and ship surface equipment to yard or other location per instructions.
- 6. Turn over to John Schwartz for reclamation.
- 7. Rehabilitate location according to BLM or State requirements.