State of New Mexico Energy, Minerals and Natural Resources Department Oil Conservation Division

	Sundry Notices and Re	ports on Wells		
		API	# (assigned by OCD)	
			30-045-25041	
1. Type of Well GAS		5.	Lease Number	
		6.	State Oil&Gas Lease : B-11133-28	
2. Name of Operator		7.		
BURLINGTON				
RESOURCES OIL	8.	San Juan 32-9 Unit Well No.		
3. Address & Phone No. of Opera	ator		25 A	
PO Box 4289, Farmington, N		9.	Pool Name or Wildcat Blanco Mesaverde	
4. Location of Well, Footage, S	Sec., T, R, M	10.	Elevation:	
1090'FSL 910'FEL, Sec.2, T-3		uan County		
Type of Submission	Type of Act			
$_{ m X}_{ m N}$ Notice of Intent	Abandonment	_ Change of Pl		
Colorana Barran	Recompletion	New Construc Non-Routine	tion Eracturing	
Subsequent Report	Plugging Back Casing Repair	Non-Routine Water Shut o		
Final Abandonment	Casing Repair Altering Casing			
	X Other -	_	3 ·	
It is intended to install attached procedur			to the	
(This space for State Use)	(LTL5) Regulatory	Administrator_	_February 1, 1999 TLW	

1	

San Juan 32-9 Unit #25A Blanco Mesaverde

1090'FSL, 910' FEL

Unit P, Section 2, T-31-N, R-10-W Latitude / Longitude: 36°55.3509' / 107°50.7495'

AIN: 7000801

Recommended Rod Pump Installation Procedure 1/21/99

Project Justification: The SJ 32-9 Unit #25A was completed in 1981 in the Mesaverde formation. Nine swabbing jobs during 1990 convinced Production Operations to install a rod pump in the well. At that time, the well was producing approximately 30 BOPD and had problems with excessive paraffin deposition in the tubing. After several pump repairs (which are thought to have been caused by sand production, continuing to stroke the pump after the liquid level had been pumped off, and paraffin deposition on the rod string), the pumping unit was removed in March 1996. Until recently, the well was producing relatively problem-free due to a compressor/plunger lift combination. The lease operator reports that the approximate 10 BLPD in conjunction with increased paraffin production due to lower surface pressures has caused the plunger lift to become ineffective. Originally, paraffin scrapers were run on the rods to a depth of 1925' (the top of the Ojo Alamo is estimated at 1787'), but when the pump was removed in March 1996, heavy paraffin was discovered from 2000-3000°. It is proposed to install a rod pump with a sand screen, and paraffin scrapers on the sucker rods to a depth of 4000'. This will be justified by increased gas production up the tubing/easing annulus and the well becoming less time consuming for the lease operator.

- 1. Install used C-160 pumping unit.
- Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Prior to 2. moving in rig, make one-call and then verify rig anchors and dig pit.
- 3. MOL and RU workover rig. Obtain and record all wellhead pressures. NU relief line. Blow well down and kill with 2% KCL water if necessary. ND WH and NU BOP with stripping head. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary.
- NOTE: This well produces with a plunger lift system. Mesaverde, 2-3/8", 4.7# J-55 tubing is set at 5820'. Broach 4. tubing and set tubing plug in tubing at 5766'. Fill tubing with half of its volume of 2% KCL to insure the tubing plug will be held in place. Release donut; pick up additional joints of tubing and tag bottom. (Record depth). TOOH with tubing. PBTD should be at ±5890°. Visually inspect tubing for corrosion and replace any bad joints. Remove any unnecessary equipment (i.e. tubing stop, bumper spring, etc.). Check tubing for scale build-up and notify Operations Engineer.
- PU and TIH with 3-7/8" bit, bit sub and watermelon mill on 2-3/8" tubing and round trip to below perforations, 5. cleaning out with air/mist. NOTE: When using air/mist, minimum mist rate is 12 bph. If scale is present, contact Operations Engineer to determine methodology for removing scale from easing and perforations.
- Rabbit all tubing prior to TIII. TIII with one joint of 2-3/8" 4.7# tubing, 4" perforated sub, in-line check, 1.78" seating 6. nipple, and then remaining 2-3/8" tubing. Replace any bad joints.
- 7. Land tubing at ±5870. NOTE: If excessive fill is encountered, discuss this landing depth with Operations Engineer. Pump off check valve. ND BOP and NU WH.
- 8. PU and TIH with 1" x 8' sand screen, 2" x 1.25" x 10' x 14' RHAC-Z insert pump, from Energy Pump & Supply, 1 1-1/4" sinker bar (5/8" pin with ¼" crossover), ¼" Grade D rods with spray-metal couplings to 4000', and molded paraffin scrapers to surface. Test pump action and hang rods on pumping unit. RD and MOL. Return well to production.

Approved: Bruce U. Boys 1.36.99
Drilling Superintendent

Operations Engineer:

L. Tom Loveland

Office - (326-9771)

Home - (564-4418)

Pager - (324-2568)

Pump and Rods:

Energy Pump & Supply

Leo Noves

Office - (564-2874)