

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well  
☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Koch Exploration Company

3. Address and Telephone No.

P.O. BOX 489 Aztec, NM 87410

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Sec. 31, T32N-R8W (M)  
790' FSL & 750' FWL

5. Lease Designation and Serial No.

NM-013642

6. If Indian, Allottee or Tribe Name

NA

7. If Unit or CA, Agreement Designation

NA

8. Well Name and No.

GARDNER C

9. API Well No.

3

10. Field and Pool, or Exploratory Area

BASIN FRUITLAND COAL

11. County or Parish, State

SAN JUAN, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent  
☒ Subsequent Report  
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment  
☐ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☐ Other  
☒ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☐ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

We tried to fish 5½ liner from well bore to clean out well, but the 5½ liner came apart. We brought out only 80' of liner. We tried to clean out beside liner left in well bore but had no luck, could not keep liner off of bit. After no success with regular bit, we tried a mill and almost was stuck twice at the same point. At this time we decided to side track well. We set a 7" plug @2855' KB, which abandoned initial well bore. We cut a window from (top) 2855' KB thru (bottom) 2862' KB and set initial angle of 3-3½ degrees. Drilled to 3007' KB with directional motor then continued to clean with regular bit to TD of 3360' KB. We raised our initial TD due to no show of coal section below 3360' KB on logs. TD now is 78' North-West 39 degrees from initial TD. Cleaning out new well bore. Date we began to side track well we 6-25-94.

14. I hereby certify that the foregoing is true and correct

Signed

*Donald F. John*

Title

FOREMAN

Date

6-28-94

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any:

ACCEPTED FOR RECORD

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

\*See instruction on Reverse Side

FARMINGTON DISTRICT OFFICE  
BY *smn*