

Coal Creek Oil Co
Graham #1

DIVISION APPROVED PLUGGING PROGRAM

1. Clean out and/or drill out hole to TD at 682'.
2. Set a cement plug 682' to 500'.
3. Come out of hole and WOC a minimum of 4 hours. Go back in hole with tubing and tag plug. If plug is above 550' go to step 4. If not fill to 500'.
4. Set a top plug 150' to surface.
5. Set dry hole marker, fill pits, clean and level location.

All plugs to be with neat cement with or without an accelerator. Plugs to be separated with gel mud weighing a minimum of 9# gal.