OCD-HOBBS

Form 3160-5 (June 1990)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED

Budget Bureau No. 1004-0135

Expires: March 31,1993

SUNDRY NOTICES AND REPORTS ON WELLS

5 Lease Designation and Serial No NM 0103893

Water Shut-Off

Dispose Water

Conversion to Injection

(Note Report results of multiple completion on Well Completion or Recompletion Report and Log form)

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. 6. If Indian, Allotted or Tribe Name Use "APPLICATION FOR PERMIT -" for such proposals SUBMIT IN TRIPLICATE 1 Type of Well 7 If Unit or CA, Agreement Designation Gas Wel Other 2. Name of Operator 8. Well Name and No. **Dugan Production Corp.** Allied 93 #3 3 Address and Telephone No. 9. API Well No. P.O. Box 420, Farmington, NM 87499 (505) 325 - 1821 30 025 24681 Location of Well (Footage, Sec , T., R , M , or Survey Description) 10. Field and Pool, or Exploratory Area 1980' FWL & 2080' FSL (Unit K) Sawyer (San Andres) NE/4 SW/4, Sec. 24, T9S, R37E, NMPM 11. County or Parish, State Lea, NM 12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent Abandonment Change of Plans Recompletion \Box **New Construction** Subsequent Report Plugging Back Non-Routine Fracturing

13 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Casing Repair

Altering Casing

Other

П

Tubing stuck. Unable to work free. Back off tubing @ 2556'. Pulled free tubing. Screwed back on to tubing. Unable to pump into well. Call BLM Wesley Ingram. Got approval to start plugging. Unscrewed tubing. Pulled 2556' of tubing. Perforated @ 2550'. Ran packer to 2500'. Unable to pump into perforated zone. Call BLM. Spot 25 sx @ 2556'. Wait on cement. Tagged cement @ 2236'. Circulated plugging mud. Perforated @ 1200'. Ran tubing to 1250'. Pressured up on casing, held 800 psi. Spot 25 sx. Cement at 1250'. Tagged cement @ 904'. Perforated @ 466'. Pumped 35 sx cement into perforated interval. Tagged @ 350'. Perforate @ 60'. Circulate 25 sx to surface. ND BOP. NU wellhead. Dig out cellar. Cut off wellhead. Install P&A marker. Job complete 8/8/07

APPROVED AS TO PLUGGING OF THIS WELL BORE LIABILITY UNDER BOND IS COMPLETED

14 I hereby certify that the foregoing is true and correct

Signed John Alexander

Vice-President Date 8/29/2007

Approved by SI DAVID R. GLASS

PETROLEUM ENGINEER Date SEP 14 2007

Conditions of approval, if any

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction



Final Abandonment Notice