

State of New Mexico Energy, Minerals and Natural Resources Department


Form C-103 Revised 5-27-2004

FILE IN TRIPLICATE 2 0 2008 OIL CONSERVATION DIVISION	
DISTRICT II DISTRICT II OCT 2 0 2008 1220 South St. Francis Dr. Santa Fe, NM 87505	WELL API NO. 30-025-26622
DISTRICT II	5. Indicate Type of Lease
1301 W Grand Ave, Artesia, NM 88210	STATE FEE X
DISTRICT III 1000 Rio Brazos Rd, Aztec, NM 87410	6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	South Hobbs (G/SA) Unit
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals.)	Section 3
1 Type of Well:	8. Well No. 174
Oil Well Gas Well Other Injector 2 Name of Operator	9. OGRID No 157984
Occidental Permian Ltd.	9. OURID NO 13/984
3. Address of Operator	10. Pool name or Wildcat Hobbs (G/SA)
HCR 1 Box 90 Denver City, TX 79323	
4. Well Location	
Unit Letter L : 2026 Feet From The South 516 Fee	t From The West Line
Section 3 Township 19-S Range 38-F	NMPM Lea County
11. Elevation (Show whether DF, RKB, RT GR, etc.) 3622' KB	
Pit or Below-grade Tank Application or Closure	
Pit Type Depth of Ground Water Distance from nearest fresh water well Distance from nearest surface water	
Pit Liner Thickness mil Below-Grade Tank: Volume bbls; Construction Material	
The Zinet Time Michael In Solot Grade Tank. Totaline	-
12. Check Appropriate Box to Indicate Nature of Notice, Report, or C NOTICE OF INTENTION TO: SUBS	Other Data SEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OP	NS. PLUG & ABANDONMENT
PULL OR ALTER CASING Multiple Completion CASING TEST AND CEMEN	т јов
OTHER: Clean out/Plug	back/OAP/Acid treat X
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates	
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates	
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP.	
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of 1. RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer.	
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars.	completion or recompletion.
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of the Rule of the	completion or recompletion.
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of retainer. RD HES. 5. RIH w/bit & drill collars. Tag cement @3990'. RU power swivel & stripperhead. Drill out ceme	ement. Reverse out. 53 bbl of cement left under
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of retainer. RD HES. 5. RIH w/bit & drill collars. Tag cement @3990'. RU power swivel & stripperhead. Drill out ceme CICR and cement from 4001-4238'. Circulate clean. RD power swivel and stripperhead. POOH w/l	ement. Reverse out. 53 bbl of cement left under nt on retainer from 3990 to 4001'. Drill out bit & drill collars.
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of retainer. RD HES. 5. RIH w/bit & drill collars. Tag cement @3990'. RU power swivel & stripperhead. Drill out ceme CICR and cement from 4001-4238'. Circulate clean. RD power swivel and stripperhead. POOH w/16. RU wireline and perforate well @4098-4124', 4144-52', 4157-87', 4197-4206', 4211-13', 4217-2	ement. Reverse out. 53 bbl of cement left under nt on retainer from 3990 to 4001'. Drill out bit & drill collars. 5' @2 JSPF. RD wireline.
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of retainer. RD HES. 5. RIH w/bit & drill collars. Tag cement @3990'. RU power swivel & stripperhead. Drill out ceme CICR and cement from 4001-4238'. Circulate clean. RD power swivel and stripperhead. POOH w/l	ement. Reverse out. 53 bbl of cement left under nt on retainer from 3990 to 4001'. Drill out bit & drill collars. 5' @2 JSPF. RD wireline.
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of retainer. RD HES. 5. RIH w/bit & drill collars. Tag cement @3990'. RU power swivel & stripperhead. Drill out ceme CICR and cement from 4001-4238'. Circulate clean. RD power swivel and stripperhead. POOH w/16. RU wireline and perforate well @4098-4124', 4144-52', 4157-87', 4197-4206', 4211-13', 4217-27. RIH w/PPI packer set @4244'. RU HES & acid treat perfs w/2700 gal of 15% NEFE HCL acid in	ement. Reverse out. 53 bbl of cement left under on retainer from 3990 to 4001'. Drill out bit & drill collars. 5' @2 JSPF. RD wireline. 3 stages. RD HES. POOH w/PPI packer.
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of retainer. RD HES. 5. RIH w/bit & drill collars. Tag cement @3990'. RU power swivel & stripperhead. Drill out ceme CICR and cement from 4001-4238'. Circulate clean. RD power swivel and stripperhead. POOH w/l. 6. RU wireline and perforate well @4098-4124', 4144-52', 4157-87', 4197-4206', 4211-13', 4217-27. RIH w/PPI packer set @4244'. RU HES & acid treat perfs w/2700 gal of 15% NEFE HCL acid in 8. RIH w/7' Arrowset 1-X packer on 128 jts of 2-3/8" IPC tubing. Packer set @4007'. ***see additional data on attached sheet	ement. Reverse out. 53 bbl of cement left under nt on retainer from 3990 to 4001'. Drill out bit & drill collars. 5' @2 JSPF. RD wireline. 3 stages. RD HES. POOH w/PPI packer.
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of retainer. RD HES. 5. RIH w/bit & drill collars. Tag cement @3990'. RU power swivel & stripperhead. Drill out ceme CICR and cement from 4001-4238'. Circulate clean. RD power swivel and stripperhead. POOH w/16. RU wireline and perforate well @4098-4124', 4144-52', 4157-87', 4197-4206', 4211-13', 4217-27. RIH w/PPI packer set @4244'. RU HES & acid treat perfs w/2700 gal of 15% NEFE HCL acid in 8. RIH w/7' Arrowset 1-X packer on 128 jts of 2-3/8'' IPC tubing. Packer set @4007'.	ement. Reverse out. 53 bbl of cement left under nt on retainer from 3990 to 4001'. Drill out bit & drill collars. 5' @2 JSPF. RD wireline. 3 stages. RD HES. POOH w/PPI packer.
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of retainer. RD HES. 5. RIH w/bit & drill collars. Tag cement @3990'. RU power swivel & stripperhead. Drill out ceme CICR and cement from 4001-4238'. Circulate clean. RD power swivel and stripperhead. POOH w/l 6. RU wireline and perforate well @4098-4124', 4144-52', 4157-87', 4197-4206', 4211-13', 4217-27. RIH w/PPI packer set @4244'. RU HES & acid treat perfs w/2700 gal of 15% NEFE HCL acid in 8. RIH w/7' Arrowset 1-X packer on 128 jts of 2-3/8" IPC tubing. Packer set @4007'. ***see additional data on attached sheet I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify	ement. Reverse out. 53 bbl of cement left under nt on retainer from 3990 to 4001'. Drill out bit & drill collars. 5' @2 JSPF. RD wireline. 3 stages. RD HES. POOH w/PPI packer.
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of retainer. RD HES. 5. RIH w/bit & drill collars. Tag cement @3990'. RU power swivel & stripperhead. Drill out ceme CICR and cement from 4001-4238'. Circulate clean. RD power swivel and stripperhead. POOH w/l 6. RU wireline and perforate well @4098-4124', 4144-52', 4157-87', 4197-4206', 4211-13', 4217-27. RIH w/PPI packer set @4244'. RU HES & acid treat perfs w/2700 gal of 15% NEFE HCL acid in 8. RIH w/7' Arrowset 1-X packer on 128 jts of 2-3/8" IPC tubing. Packer set @4007'. ****see additional data on attached sheet I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify constructed or	ement. Reverse out. 53 bbl of cement left under nt on retainer from 3990 to 4001'. Drill out bit & drill collars. 5' @2 JSPF. RD wireline. 3 stages. RD HES. POOH w/PPI packer.
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of retainer. RD HES. 5. RIH w/bit & drill collars. Tag cement @3990'. RU power swivel & stripperhead. Drill out ceme CICR and cement from 4001-4238'. Circulate clean. RD power swivel and stripperhead. POOH w/l 6. RU wireline and perforate well @4098-4124', 4144-52', 4157-87', 4197-4206', 4211-13', 4217-27. RIH w/PPI packer set @4244'. RU HES & acid treat perfs w/2700 gal of 15% NEFE HCL acid in 8. RIH w/7' Arrowset 1-X packer on 128 jts of 2-3/8" IPC tubing. Packer set @4007'. ***see additional data on attached sheet I hereby certify that the information above is true and complete to the best of my knowledge and belief 1 further certify constructed or closed according to NMOCD guidelines 7. A general permit or an (attached) alternative or an (attached) alternative or an extraction of the proposed according to NMOCD guidelines or an according to the proposed according to NMOCD guidelines or an according to the proposed ac	ement. Reverse out. 53 bbl of cement left under nt on retainer from 3990 to 4001'. Drill out bit & drill collars. 5' @2 JSPF. RD wireline. 3 stages. RD HES. POOH w/PPI packer. *** Chat any pit or below-grade tank has been/will be
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of retainer. RD HES. 5. RIH w/bit & drill collars. Tag cement @3990'. RU power swivel & stripperhead. Drill out ceme CICR and cement from 4001-4238'. Circulate clean. RD power swivel and stripperhead. POOH w/16. RU wireline and perforate well @4098-4124', 4144-52', 4157-87', 4197-4206', 4211-13', 4217-27. RIH w/PPI packer set @4244'. RU HES & acid treat perfs w/2700 gal of 15% NEFE HCL acid in 8. RIH w/7" Arrowset 1-X packer on 128 jts of 2-3/8" IPC tubing. Packer set @4007'. ***see additional data on attached sheet I hereby certify that the information above is true and complete to the best of my knowledge and belief 1 further certify constructed or closed according to NMOCD guidelines 7. A general permit or an (attached) alternative plan	ement. Reverse out. 53 bbl of cement left under nt on retainer from 3990 to 4001'. Drill out bit & drill collars. 5' @2 JSPF. RD wireline. 3 stages. RD HES. POOH w/PPI packer. *** Chat any pit or below-grade tank has been/will be
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of retainer. RD HES. 5. RIH w/bit & drill collars. Tag cement @3990'. RU power swivel & stripperhead. Drill out ceme CICR and cement from 4001-4238'. Circulate clean. RD power swivel and stripperhead. POOH w/16. RU wireline and perforate well @4098-4124', 4144-52', 4157-87', 4197-4206', 4211-13', 4217-27. RIH w/PPI packer set @4244'. RU HES & acid treat perfs w/2700 gal of 15% NEFE HCL acid in 8. RIH w/7" Arrowset 1-X packer on 128 jts of 2-3/8" IPC tubing. Packer set @4007'. ***see additional data on attached sheet I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify constructed or closed according to NMOCD guidelines. Administrative. SIGNATURE TITLE Administrative.	ement. Reverse out. 53 bbl of cement left under not on retainer from 3990 to 4001'. Drill out bit & drill collars. 5' @2 JSPF. RD wireline. 3 stages. RD HES. POOH w/PPI packer. *** Chat any pit or below-grade tank has been/will be COCD-approved Associate DATE 10/17/2008
proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of 1. RUPU & RU. ND wellhead/NU BOP. 2. POOH w/tubing and packer. 3. RIH w/bit & drill collars. Tag fill @4298'. POOH w/bit & drill collars. 4. RIH w/CICR set @4001'. RU HES & squeeze off all perfs below CICR w/300 sxs of Prem Plus of retainer. RD HES. 5. RIH w/bit & drill collars. Tag cement @3990'. RU power swivel & stripperhead. Drill out ceme CICR and cement from 4001-4238'. Circulate clean. RD power swivel and stripperhead. POOH w/l 6. RU wireline and perforate well @4098-4124', 4144-52', 4157-87', 4197-4206', 4211-13', 4217-27. RIH w/PPI packer set @4244'. RU HES & acid treat perfs w/2700 gal of 15% NEFE HCL acid in 8. RIH w/7" Arrowset 1-X packer on 128 jts of 2-3/8" IPC tubing. Packer set @4007'. ****see additional data on attached sheet I hereby certify that the information above is true and complete to the best of my knowledge and belief 1 further certify constructed or closed according to NMOCD guidelines , a general permit or an (attached) alternative plan SIGNATURE TITLE Administrative TYPE OR PRINT NAME Mendy A Johnson E-mail address: mendy johnson@oxy.com	ement. Reverse out. 53 bbl of cement left under not on retainer from 3990 to 4001'. Drill out bit & drill collars. 5' @2 JSPF. RD wireline. 3 stages. RD HES. POOH w/PPI packer. *** Chat any pit or below-grade tank has been/will be COCD-approved Associate DATE 10/17/2008

SHU 174

- 9. ND BOP/NU wellhead
- 10. Test casing to 580# for 30 minutes and chart for the NMOCD.11. RDPU & RU. Clean location and return well to injection.

RUPU 09-17-08 RDPU 09-29-08

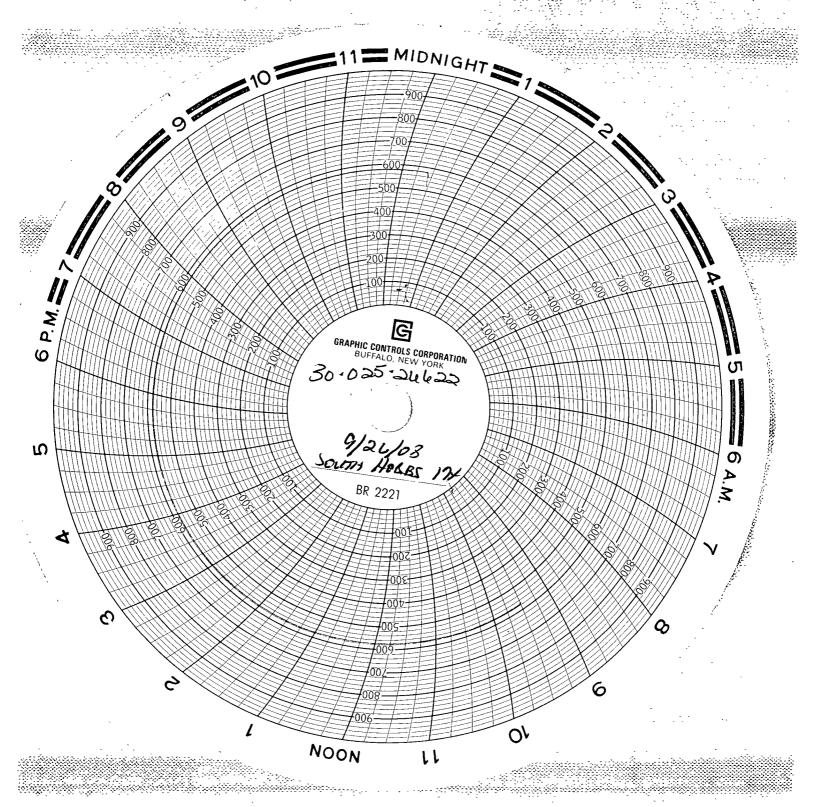

DXY, SOUTH HOBBS 174
2310 FNL X990 FWL
2310 FNL X990 FWL
SEC. 4, T19-S, R38-E.
SEC. 4, T19-S, R38-E.
WHAT LETTER E, HOBBS GSA FIEND
UNIT LETTER E, HOBBS GSA FIEND
LARMY CLINTON - WEATHERFORD
126108
CHART REDWER - PATE TWCKING
CANBRATED 7-2-08
CANBRATED 7-2-08