

MIDLAND E & P DIVISION

WELL WORK RECOMMENDATIONS
Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease: SANTA FE PACIFIC CROW Well No. E-1
Field: CROSSROADS PENN
County: LEA State: NEW MEXICO

RECOMMENDED PROCEDURE:

1. M.I.P.H. - PULL 5" PLASTIC COATED TBS.
2. RUN 2" TUBING (MUST BE PICKED UP) AND SPOT
35 SA PLUG OVER PERFORATED INTERVAL (8880-9598')
BACK TO 8700'
3. TAG PLUG AFTER INITIAL SET. IF PLUG
DOES NOT SET. RUN RETAINER TO 8700' AND
SQUEEZE PERFORATIONS (8880-9598')
4. CIRCULATE HOLE TO MUD LADEN FLUID
AND PULL TUBING
5. SPOT 25 SA CEMENT PLUG OVER LINER
@ 4028'
6. SPOT 10 SA CEMENT PLUG @ SURFACE
7. CUT OFF WELLHEAD AND INSTALL MARKER

NOTE: NO CASING AVAILABLE FOR ECONOMIC SALVAGE