

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**WELL CONSERVATION DIVISION**

2040 Pacheco St.  
Santa Fe, 87505

WELL API NO. 30-025-03627
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:  
 OIL WELL       GAS WELL       OTHER SWD

2. Name of Operator  
 Saga Petroleum LLC of CO

3. Address of Operator  
 415 W. Wall, Suite 835, Midland, TX 79701

4. Well Location  
 Unit Letter A : 660 Feet From The East Line and 660 Feet From The North Line  
 Section 33 Township 9S Range 36E NMPM Lea County

7. Lease Name or Unit Agreement Name  
 U.D. Sawyer

8. Well No.  
 1

9. Pool name or Wildcat  
 Crossroads, Siluro-Devonian

10. Elevation (Show whether DF, RKB, RI, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

<b>NOTICE OF INTENTION TO:</b>		<b>SUBSEQUENT REPORT OF:</b>	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: _____ <input type="checkbox"/>		OTHER: _____ <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

See attached

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Chris Hodge TITLE Production Analyst DATE 5/7/97

TYPE OR PRINT NAME \_\_\_\_\_ TELEPHONE NO. \_\_\_\_\_

(This space for State Use)

APPROVED BY Orig. Signed by Paul Kautz Geologist TITLE \_\_\_\_\_ DATE MAY 22 1997

CONDITIONS OF APPROVAL, IF ANY:

**Saga Petroleum  
Daily Workover Report**

**U.D. Sawyer SWD #1**

- 4/18/97 MIRU Unit 6011. SD for weekend.
- 4/21/97 MIRU Weatherford. RU KTS Pmp Truck. Pumped 375 bbls PW, kill well. NDWH. Pulled & LD 5 jts 4-1/2" csg. Tong broke dn. SDFN.
- 4/22/97 MIRU Weatherford. MIRU KTS Pmp Truck. Pumped 300 bbls PW & kill well. Pulled & LD 28 jts 4-1/2" csg + 24' parted jt. RD Weatherford. NU BOP. MI Star Tool. PU 6-3/4" overshot. MI & unload 2-7/8" tbg from Eagle Pipe. PU 69 jts, tag up @ 2177'. Top of fish should have been @ 1362'. Pulled over shot out of hole. SDFN.
- 4/23/97 PU overshot 6-3/8", tag up @ 2177'. Pulled tools out of hole, LD overshot. PU 6-3/4" bit & bit sub. Tag up @ 2177'. Worked for 2-1/2 hrs, would not go. RU KTS Pmp Truck. Pmpd 90 bbls PW. Worked dn to 2166'. Pulled bit & bit sub out of hole. LD tools. Ran tbg w/ 2-7/8" tbg collar on btm. Tag up @ 2182'. PU & hung up 2180'. Turn pipe came lose. Pulled tbg out of hole. Cas claps & parted. SDFN.
- 4/24/97 PU 6-1/2 Lead block. Tag up @ 2172'. Pulled & LD lead block. Csg collapsed. Waited on tools. PU 3-13/16" swedged bumper sub jars, 6 DC 4-3/4". TIH. Tag up @ 2185'. Worked dn to 2209'. Lose Swedge. Pulled tools out of hole. Broke pin off x-over. LD tools. SDFN.
- 4/25/97 PU overshot 4-5/8". Tag up @ 2176'. Worked up & down turn pipe to right, could not fish collar. POOH w/ tools. LD overshot. SDFN.
- 4/26/97 Open well up. PU one jt 2-7/8" tbg. Bent jt. PU taper tap. TIH & Tag up @ 2179'. Worked tool up & dn. Could not fish DC. Pulled tool out of hole. Bent tub more, ran tools in hole to 2179', could not fish. SDFN.
- 4/27/97 Open well up. LD tub, DC & tools. ND BOP. NUWH. Evaluating for P&A.