

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

## SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>		7. Unit Agreement Name
2. Name of Operator Tom L. Ingram		8. Farm or Lease Name Cryer
3. Address of Operator POB 1757, ROSWELL, NEW MEXICO 88201		9. Well No. 1
4. Location of Well UNIT LETTER <u>L</u> <u>1980</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>34</u> TOWNSHIP <u>10S</u> RANGE <u>36E</u> NMPM.		10. Field and Pool, or Wildcat Dickinson-Penn
15. Elevation (Show whether DF, RT, GR, etc.) 4015 KB		12. County Lea

## Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1705.

10-15 thru 10-27-73: Cut 2-3/8" tubing @ 8965. Set 25 sk. plug @ 8965 - 8765. Shot 5 1/2" casing @ 8290 & @ 7377. Unable to pull. Shot casing @ 6400 and pulled. Set 25 sk. plug @ 6450 to 6348. Set 45 sk. plug @ 5670-5570. Set 45 sk. plug @ 4277-4177 (base of 8-5/8) Shot 8-5/8" casing @ 1217, 913 and 843. Unable to move. Shot @ 621 and pulled. Set 45 sk. cement plug @ 671 to 571, (top of 8-5/8"). Set 65 sk. plug @ 395-295 (base of surface). Set a 10 sk. plug @ surface. Erected marker. Mud laden brine placed between all plugs. Will notify when location is cleaned and ready for inspection.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Tom L. Ingram TITLE Operator DATE Nov. 6, 1973

APPROVED BY John W. Ramsey TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: