

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <u>Saltwater Disposal Well</u>		7. Unit Agreement Name
2. Name of Operator <u>Enserch Exploration, Inc.,</u>		8. Farm or Lease Name <u>Sante Fe</u>
3. Address of Operator <u>P.O. Box 4815, Midland, Texas 79704</u>		9. Well No. <u>2</u>
4. Location of Well UNIT LETTER <u>0</u> , <u>660</u> FEET FROM THE <u>South</u> LINE AND <u>1980</u> FEET FROM THE <u>East</u> LINE, SECTION <u>19</u> TOWNSHIP <u>9S</u> RANGE <u>37E</u> NMPM.		10. Field and Pool, or Wildcat <u>E. Crossroad/Dev.</u>
15. Elevation (Show whether DF, RT, GR, etc.) <u>4001' GR</u>		12. County <u>Lea</u>

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
PLUG AND ABANDON <input checked="" type="checkbox"/>	OTHER <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
OTHER <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Set CI bridge plug at 11,549' w/43' cement on top 5sx.
  - Set 100' cement plug from 7200' to 7100' and tag.
  - Set 100' cement plug from 5574' to 5474 (base of San Andres) and tag.
  - Set 100' cement plug from 4360 to 4260 (base of 9 5/8" casing) and tag.
  - Perforate at 1800' set retainer at 1757' pumped 745sx cement in perforations. Had returns to surface on 715sx, lost returns on last 30sx.
  - 10sx plug at surface with marker.
- Note hole filled with mud laden fluid as plugs were set.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED H. F. Burnett TITLE Production Superintendent DATE April 21, 1981

APPROVED BY Jerry Sexton TITLE \_\_\_\_\_ DATE APR 26 1981

CONDITIONS OF APPROVAL, IF ANY: