

HOBBS OFFICE O. C. C.

DEC 14 11 56 AM '65

(SE/4 of NW/4) of this NW/4 of 19.

The proposed plugging and abandoning program is as follows:

1. Place a cement plug from 4875 to total depth of 5011. 7" casing is set at 4926. Open hole 4926 to 5011.
2. Attempt to recover 7" casing by cutting and pulling above 2250 feet. Note - cement was squeezed at 2322. Place 100 foot cement plug in and out of 7" casing stub.
3. Place 100 foot cement plug across shoe of the 13-3/8" surface casing at 320 feet.
4. Place 20 foot cement plug at top of surface casing.
5. Place mud of at least 10 pound weight between all cement plugs.
6. Place regulation marker in top of surface cement plug.

This plugging and abandoning operation is planned shortly after December 26, 1965. When completed and ready for inspection Form 9-331 will be filed detailing the work actually performed.

XERO
COPY

XERO
COPY

XERO
COPY

XERO
COPY