

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease
State ☐ For ☒

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT - " (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator Union Oil Company of California	8. Farm or Lease Name Vada Lee Pruitt
3. Address of Operator P. O. Box 671 Midland, Texas 79702	9. Well No. 1
4. Location of Well UNIT LETTER <u>J</u> 1980 FEET FROM THE <u>South</u> LINE AND 1980 FEET FROM THE <u>East</u> LINE, SECTION <u>21</u> TOWNSHIP <u>9-S</u> RANGE <u>34-E</u> N.M.P.M.	10. Field and Pool, or WHdcat Vada Penn
11. Elevation (Show whether DF, RT, GR, etc.) 4256' GR	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1 - Notify New Mexico Oil Conservation Commission prior to MI RU.
- 2 - MIRU csg pullers. Install BOP POOH w/tbg string. Run 2-3/8" tbg work string OE'd to 9739' (top of fish).
- 3 - Circ hole w/9.5# mud.
- 4 - Spot 35 sx cmt plug from 9739' - 9455'. WOC & tag(TOC should be at least 9639') POOH.
- 5 - Cut & pull 5-1/2" csg @ 5415' (top of Glorieta). Run tbg to 5465'.
- 6 - Spot 35 sx cmt plug from 5465' - 5325' (this will take care of NMOCC requirements for 100' plug (50' in 50' out) across 5-1/2" csg stub & 50' plug above top of Glorieta.
- 7 - PU to 4073'. Spot 50 sx cmt plug across 8-5/8" csg shoe from 4073' to 3920'.
- 8 - PU to 1385'. Spot 50 sx cmt plug across 8-5/8" csg stub from 1385' to 1230'.
- 9 - PU to 413'. Spot 65 sx plug across 11-3/4" csg shoe from 413' to 283'.
- 10 - Spot 10 sx plug @ surface. Cut off well heads. Weld on 1/4" steel plate, install dry hole marker, RD csg pullers and clean location.

14. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED J. R. Hughes TITLE Dist. Dir. Supt. DATE 6-9-83

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT 1 SUPERVISOR

JUN 16 1983

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
JUN 15 1983
O.C.D.
HOBBS OFFICE