Workover- New Mexico A State Well #1

Cut tubing @ 9575<sup>1</sup>. Pulled tubing. 3-31-67 ran Bowen overshot, jars, on 2 7/8<sup>n</sup> tubing. 4-1-67, jarred on fish. Unable to free. Attempted to release overshot, unable to release. 4-3-67 ran free point indicator and string shot. Backed off @ 9563. 4-4-67 pulled 2 7/8<sup>n</sup> tubing, and jars. Left fish of Bowen overshot, 2 1/2 jts. of 2 7/8<sup>n</sup> tubing and Baker R packer in well. Reran tubing seated & 9468, packer at 9460<sup>1</sup>. Loaded annulus w/45 bbls fresh water. Tested casing above packer, 1500 psi o.k. Swabbed 55 bbls salt water w/ trace of oil. 4-5-67 swabbed 3 1/2 hours. Rec. 2 BSW, trace oil. Let well stand 1 hour. Ran swab - no fluid entry. Pulled and layed down tubing. Installed well head. Well standing.