

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-20599
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. K-169
7. Lease Name or Unit Agreement Name Patton AAR State
8. Well No. #3 - SWD
9. Pool name or Wildcat SWD - San Andres

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER SWD	
2. Name of Operator YATES PETROLEUM CORPORATION	
3. Address of Operator 105 South 4th St., Artesia, NM 88210	
4. Well Location Unit Letter J : 1980 Feet From The South Line and 1980 Feet From The East Line Section 5 Township 9S Range 32E NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
<b>NOTICE OF INTENTION TO:</b>	<b>SUBSEQUENT REPORT OF:</b>
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to plug and abandon as follows:

1. Nipple down wellhead. Nipple up BOP. TOOH with tubing.
2. RIH with gauge ring to 4175'. Set a CIBP at 4175' and cap with 35' of cement.
3. TIH with tubing and tag CIBP. Load casing with 10# brine gel mud. TOOH with tubing.
4. Make up landing joint on 5-1/2" casing. Pull casing and wireline cut casing at 2700'±. TOOH with casing.
5. Set a 35 sack Class Cement plug from 50' below casing cut to 50' above. Use 2% CaCl2. WOC 2 hours. Tag plug. NOTE: Cement - 14.8#
6. Set a 35 sack Class C cement plug from 1651-1551' - 14.8# cement.
7. Set a 40 sack Class C cement plug from 463-312' - 14.8# cement.
8. Set a 10 sack Class C cement plug at surface.
9. Install regulation abandonment marker.

See attached before and after downhole diagrams.

NOTIFY OCD-HOBBS (505-393-6161) 24 HOURS PRIOR TO COMMENCING PLUGGING OPERATIONS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Rusty Klein TITLE Operations Technician DATE June 17, 1999  
TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505/748-147

(This space for State Use) ORIGINAL SIGNED BY

GARY WINK  
FIELD REP. II

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE 7-7-99

CONDITIONS OF APPROVAL, IF ANY:

JP