

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. <b>OG-4084</b>
7. Unit Agreement Name
8. Farm or Lease Name <b>STATE II-23</b>
9. Well No. <b>6</b>
10. Field and Pool, or Wildcat <b>MESCALERO SAN ANDRES</b>
12. County <b>LEA</b>

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER

2. Name of Operator  
**Continental Oil Company**

3. Address of Operator  
**P. O. Box 460, Hobbs, New Mexico 88240**

4. Location of Well  
UNIT LETTER **F** **1980** FEET FROM THE **North** LINE AND **1980** FEET FROM  
THE **West** LINE, SECTION **23** TOWNSHIP **10S** RANGE **32E** NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)  
**4331' DF**

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <b>REPAIR CASING</b> <input checked="" type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

**IT IS PROPOSED TO REPAIR A CASING LEAK IN THIS WELL AS FOLLOWS:**

**SET B.P. AT 3100' & SPOT SAND ON TOP TO 3085'.  
PERF 3045-47' W/2-5SPF. SET CMT. RETAINER AT  
3000'. CMT. W/400 SX. CLASS "C" & LEAVE 10-15'  
CMT. ON TOP OF RETAINER. WOC. DRL. OUT CMT  
& RETAINER. PRESS TEST TO 700 psi. RERUN  
PRODUCTION EQUIPT. & RETORE PROD.**

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED **Wm. E. Butterfield** TITLE **ADMIN. SUPERVISOR** DATE **4-6-76**

APPROVED BY **John E. Brown** TITLE **Geologist** DATE **4-6-76**

CONDITIONS OF APPROVAL, IF ANY  
**NMOCC (5) FILE**