

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>	
5. State Oil & Gas Lease No. NM 058102	
7. Unit Agreement Name Flying "M" (SA) Unit	
8. Farm or Lease Name Tract 10	
9. Well No. 4	
10. Field and Pool, or Wildcat Flying "M" (SA)	
12. County Lea	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- WIW	
2. Name of Operator Coastal Oil & Gas Corporation	
3. Address of Operator P. O. Box 235 Midland, Texas 79702	
4. Location of Well UNIT LETTER <u>M</u> <u>659.2</u> FEET FROM THE <u>South</u> LINE AND <u>664</u> FEET FROM THE <u>West</u> LINE, SECTION <u>16</u> TOWNSHIP <u>9-S</u> RANGE <u>33-E</u> NMPM.	
15. Elevation (Show whether DF, RT, GR, etc.) 4384 GR	

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

1-24-85 MIRU pulling unit. PU workstring and TIH. Tag plug at 4248'. Circ hole with 9.5 PPG 35 Vis mud. POH to 2500', spotted 40 sack plug, displaced with mud. POOH. Perforated 8 5/8" csg with 4 holes at 1980' and 4 holes at 390'. PU cement retainer and TIH. Set retainer at 1880' and squeeze perfs with 75 sacks Class "C" cmt. POOH. SDFN.

1-25-85 Cut off csg head and welded swage to 8 5/8" csg. Mix and pump 300 sacks Class "C" cmt thru perfs at 390'. Cmt circulated to surface. Installed P & A marker, cleaned and leveled location. Well plugged and abandoned.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Bobby L. Smith Bobby L. Smith TITLE Pet. Eng. DATE January 30, 1985

APPROVED BY Jack Griffin TITLE OIL & GAS INSPECTOR DATE JAN 26 1985

•

5