

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Oct 7 11 15 AM '65

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. E-9864	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <u>Drilling</u>		7. Unit Agreement Name -
2. Name of Operator PENNZOIL COMPANY		8. Farm or Lease Name Cone-State
3. Address of Operator 1007 Midland Savings Building, Midland, Texas		9. Well No. 1
4. Location of Well UNIT LETTER <u>F</u> , <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>35</u> TOWNSHIP <u>11-S</u> RANGE <u>36-E</u> NMPN.		10. Field and Pool, or Wildcat Wildcat
15. Elevation (Show whether DF, RT, GR, etc.) 3986' Ground Level		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Verbal permission to plug obtained from Mr. Joe Ramey, Hobbs, New Mexico.

Set 50 Sx plug from TD (13,194') back to 13,044' (Devonian)
Set 25 Sx plug from 10,000' back to 9,925' (Top of Penn)
Set 25 Sx plug from 7,912 back to 7,837' (Top of Abo)
Set 25 Sx plug from 7,213 back to 7,138' (Top of Tubb)
Set 25 Sx plug from 5,844 back to 5,769' (Top of Glorietta)
Set 25 Sx plug from 4,450 back to 4,375' (Across bottom of 8-5/8" csg)
Shot 8-5/8" csg off @ 1,245'
Set 25 Sx plug from 1,275 back to 1,210' (Across stub of 8-5/8" csg.)
Set 25 Sx plug from 400' back to 370' (Across bottom of 13-3/8" csg.)
10 Sx in top of 13-3/8" surface casing.
Installed dry hole marker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Charles W. Dorman TITLE Mgr. Drlg. & Prod. DATE 10-6-65

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: