

WELL WORK RECOMMENDATIONS
Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease: NEW MEXICO "B" Well No. 7
Field: MESQUERO - SAN ANDREA
County: LEA State: NEW MEXICO

RECOMMENDED PROCEDURE:

1. 17.5 PSI PULL PADS. PUMP & TURNING
2. RUN CASING SCAPER & CLEAN OUT TO T.O.
3. SPOT 200 GALLONS OF 15% NON-EMULSION HCL FROM
ABOUT THE BOTTOM PERFORATIONS

4. USING THE LOGS WELL (2-2000 LOGS 10-1-65)
RECORDED THE FOLLOWING ADDITIONAL HOLES
WITH 1 INCH.

4090'	4178'
4091'	4179'
4094'	4180'
4096'	4181'
4098'	4187'
	4201'
	4217'
	4222'
	4240'
	4244'

ILLEGIBLE

5. RUN TUBING AND A TREATMENT BEHIND AND
HOLD DOWN. SET PACKER AT 4000' AND BRING
DOWN THE SAN ANDREA FORMATION (4031' - 4234' - 35 HOLES)
WITH 2500 GALS OF 15% NON-EMULSION HCL ACID