NO. OF COPIES RECEIVED		Form C-103 Supersedes Old C-102 and C-103	
SANTA FE	NEW MEXICO OIL CONSERVATION COMMISSION	Effective 1-1-65	
U.S.G.S.	-+	5a. Indicate Type of Lease	
LAND OFFICE		State 🔽 🛛 Fee	
OPERATOR		5. State Oil & Gas Lease No.	
		06-93	
(DO NOT USE THIS FORM USE "A	UNDRY NOTICES AND REPORTS ON WELLS FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. PPLICATION FOR PERMIT - " (FORM C-101) FOR SUCH PROPOSALS.)		
I. OIL GAS WELL GAS	OTHER-	7. Unit Agreement Name	
2. Name of Operator	8. Farm or Lease Name		
Mobil Oil Corpo	State "BB"		
3. Address of Operator	9. Well No.		
P. O. Box 633,	4		
4. Location of Well	10. Field and Pool, or Wildcat		
UNIT LETTERO	Mescalero S.A.		
THE South	, section 14 township 10-S range 32-ENMPM.		
	15. Elevation (Show whether DF, RT, GR, etc.)	12. County	
	Lea ()))))))		
^{16.} C	4332 Gr. neck Appropriate Box To Indicate Nature of Notice, Report or Oth	er Data	
	OF INTENTION TO:		
PERFORM REMEDIAL WORK	PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING	
TEMPORARILY ABANDON	COMMENCE DRILLING OPNS.	PLUG AND ABANDONMENT	
PULL OR ALTER CASING	CHANGE PLANS CASING TEST AND CEMENT JOB		
same zone & sti	onal perforation in X	· [
same zone & sti		estimated date of starting any pro	

work) SEE RULE 1103.

Perforate additional perforation in same zone and stimulate as per procedure attached.

18. I hereby certify that the information above is true and complete	to the hes	st of my knowledge and belief.		
		Authorized Agent	DATE	8/19/70
APPROVED BY	T1TLE		DATE	
CONDITIONS OF APPROVAL, IF ANY:				

MIDLAND E & P DIVISION

WELL WORK RECOMMENDATIONS Proposals for Well Reconditioning and Subsurface Maintenance Workovers, Expense DD's, PB's, and Conversions	ł
Lease: State BB Well No. 4	
Field: Mescalence S.A.	
County: <u>Leg</u> State <u>Mexico</u>	
RECOMMENDED PROCEDURE:	
1. MIRU Pulling Unit - Pull rods, pump and tubing. Cleanout to PBD 4460' KB.	
2. G.I.H. with retrievable BP.	
3. Set BP @ 4325' and spot 5' sand on top of B.P.	
4. Spot 70 gals. 15% NE-HCL acid from 4320' up to 4250'.	
5. Perforate with one shot per foot at the following depths: 4270'-72'-74'-78 81'-95' and 4301' (Personic-GR 2-11-66)	
6. Set packer and breakdown the perfs with the acid.	
7. Swab back acid water and load oil.	
8. Unseat packer - washdown to BP and retrieve POH.	
9. R.O. and fracture treat down casing with 30,000 gals. Shell's refined oil	and
90,000# 20-40 Mesh Ottawa sand. Use 25# of Adomite Mark II per 1,000 gals	<u>.</u>
of frac fluid and 2 gals. Tret-O-Lite F-46 per 1000 gals. Inject 27 RCN	
balls evenly distributed throughout treatment. Flush w/75 bbls. lease oi	•
Treat at 25 BPM. Max treating pressure 4000 psi.	
10. Shut the well in until the pressure bleeds off or for a maximum of 24 hrs	•
11. Return well to production and test.	

ú