

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
OG - 765

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Read & Stevens, Inc.	8. Firm or Lease Name Gross
3. Address of Operator P.O. Box 2126, Roswell, New Mexico 88201	9. Well No. 1
4. Location of Well UNIT LETTER A 660 FEET FROM THE North LINE AND 660 FEET FROM THE East LINE, SECTION 15 TOWNSHIP 10 S RANGE 33 E NMPM.	10. Field and Pool, or Wilcat Inbe
15. Elevation (Show whether DF, RT, GR, etc.) 4219' KB	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Pulled well in the following manner:

1. Set cast iron bridge plug @ 9585' capped with 35' of cement.
2. Ran 2-3/8" tubing to 8000' and circulated hole with good mud. Mixed 400 bbls. of mud (brine mixed, 1 sk gel to 4 bbls. brine).
3. Cut and pulled 5 1/2" casing @ 3004'.
4. Set 50 sk cement plug 3054' to 2853'.
5. Shot 8-5/8" casing @ 1008', not free.
6. Cut and pulled 8-5/8" casing @ 840'.
7. Set 56 sk cement plug @ 890' - 790'.
8. Set 80 sk cement plug @ 401' - 301'.
9. Set 10 sk cement plug @ 10' - 0'.
10. Installed Regulation Marker.
11. Will notify when location is ready for inspection.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Agent

DATE March 21, 1972

APPROVED BY [Signature]
CONDITIONS OF APPROVAL, IF ANY:

TITLE OIL & GAS INSPECTOR

DATE SEP 21 1972

RECEIVED

APR 1972

OIL CONSERVATION COMM.
HOUSTON, TEX.