

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

SUNDRY NOTICES AND REPORTS ON WELLS DO NOT USE THIS FORM FOR PROPOSALS TO ABANDON OR PLUG A WELL OR TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT TO ABANDON OR PLUG A WELL (FORM C-101) FOR SUCH PROPOSALS.		5a. Indicate Type of Lease State ☐ Fee ☒
1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER		5. State Oil & Gas Lease No.
2. Name of Operator The Maurice L. Brown Company		6. Name of Lease Name Pruitt
3. Address of Operator Suite 200, Sutton Place Bldg., Wichita, Kansas 67202		9. Well No. 1
4. Location of Well UNIT LETTER B 660' FEET FROM THE North LINE AND 1980' FEET FROM THE East LINE, SECTION 20 TOWNSHIP 9-S RANGE 34-E N.M.P.M.		10. Field and Pool, or widest Vada Penn
15. Elevation (Show whether DF, RT, GR, etc.) 4284 GR		12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐ TEMPORARILY ABANDON ☐ PULL OR ALTER CASING ☐ OTHER ☐	PLUG AND ABANDON ☒ CHANGE PLANS ☐ OTHER ☐	REMEDIAL WORK ☐ COMMENCE DRILLING OPNS. ☐ CASING TEST AND CEMENT JOB ☐ OTHER ☐	ALTERING CASING ☐ PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Move in and rig up casing pulling rig.
2. Set cast iron bridge plug at 9760' and cap w/3sx cmt(35').
3. Load 4 1/2" casing with 10#mud.
4. Salvage 4 1/2" casing from free point.
5. Enter 4 1/2" casing stub with tubing and spot 25 sx. cmt.(50') below top of 4 1/2" casing. Tag top of cement.
6. Spot 50 sx. cement at 5350' across top of Glorieta.
7. Spot 50 sx. cement at 4050' across 8 5/8" casing shoe. Tag top of cement.
8. Spot 50 sx. cement at 2250' inside 8 5/8" casing.
9. Salvage 8 5/8" casing from approx. 1200'.
10. Enter 8 5/8" casing stub and spot 50sx. cement 50' below top.
11. Tag top of cement.
12. Spot 50 sx. cement at 421' across 13 3/8" casing shoe at 371'.
13. Spot 10 sx. cement at surface, erect dry hole marker, clean and level location.

Note: Hole will be loaded with mud laden fluid between all plugs.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Wm. Groesbeck TITLE District Engineer DATE 9-14-79

APPROVED BY Jerry Sexton TITLE Dist. 1. Supv DATE SEP 17 1979

CONDITIONS OF APPROVAL, IF ANY: