

9. Run tubing & spot 25 sxs. Plug at 5-1/2" stub.
10. Spot 25 sxs. Plug at top of Glorieta (approx. 5425').
11. Spot 25 sxs. Plug at Intermediate Shoe. POOH w/tubing.
12. Free-Point 8-5/8" casing & cut off (approx. 1900').
13. POOH w/8-5/8" casing.
14. Run tubing & spot 25 sxs. Plug at 8-5/8" stub.
15. Spot 30 sxs. Plug at 11-3/4" Shoe.
16. Spot 10 sxs. Plug at surface.
17. Weld on plate & install surface marker.
18. Clean up location for final release by government.

Calc. top of cement 5-1/2" casing 7726' (7-7/8" hole).  
Calc. top of cement 8-5/8" casing 2106' (11" hole).