

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR NOTICES TO WELL OWNERS CONCERNING PLUGGING OR A DIFFERENT RESERVOIR. USE PLUGGING FOR SERVICE PLUGGING C-102, FOR SERVICE PLUGGING C-103.)

1. ☐ OIL WELL ☐ GAS WELL ☐ OTHER

2. Name of Operator
The Maurice L. Brown Company

3. Address of Operator
Sutton Place Bldg. Suite 200, Wichita, Kansas 67202

4. Location of Well
UNIT LETTER **B** **810'** FEET FROM THE **North** LINE AND **1980'** FEET FROM
THE **East** LINE, SECTION **3** TOWNSHIP **9S** RANGE **34E** NMPH.

5. Elevation (Show whether DF, RT, GR, etc.)
4259 GL.

5a. Indicate Type of Lease
State ☐ Fee ☒

5. State Oil & Gas Lease No.

7. Unit Agreement No.

6. Form of Lease Name
Atem

9. Well No.
1

10. Field and Pool, or both
Vada Penn

12. County
Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Move in, rig up Permain Basin Casing Pullers, Inc.
2. Set cast iron bridge at 9553' and cap with 15 1/2 (2 sacks) cement.
3. Attempt to salvage 5 1/2" casing from 7000' depth.
4. Load hole with mud laden fluid.
5. Spot 35 sacks cement thru casing at cut off point.
6. Spot 35 sacks cement thru casing at 5300' across top of Glorieta estimated to be at 5250' depth.
7. Spot 35 sacks cement thru casing at 3973' across 8 5/8" casing shoe at 3923'. Top of San Andres is at 3900'.
8. Attempt to salvage 8 5/8" casing from 1200' depth.
9. Run tubing, enter 8 5/8" casing and spot 50 sacks cement 50' below top of 8 5/8" casing.
10. Spot 50 sacks cement at 424' across 13 3/8" casing shoe at 374' depth.
11. Spot 10 sacks cement at surface.
12. Erect dry hole marker.
13. Level and clean location.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS OR THE CLOSING OF THE CLOSING.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED *Wm. J. Moore* TITLE District Engineer DATE 8-13-77

APPROVED BY *Jerry Sexton* TITLE District Supervisor DATE SEP 19 1977

CONDITIONS OF APPROVAL, IF ANY: Expires 3/18/78

RECEIVED

SEP 4 1977

OIL COMPANY FROM CHARGE
HOBBS, N. M.