

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-20405
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. V 1876
7. Lease Name or Unit Agreement Name Drover State Unit
8. Well No. 2
9. Pool name or Wildcat Williams Penn

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER RE-ENTRY	
2. Name of Operator YATES PETROLEUM CORPORATION	
3. Address of Operator 105 South 4th St., Artesia, NM 88210	
4. Well Location Unit Letter H : 1980 Feet From The North Line and 660 Feet From The East Line Section 20 Township 13S Range 32E NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4338' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input checked="" type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4-30-90. Move on location, set anchors. Dressed wellhead.  
5-1-90. Move in re-entry equipment and RU. Drilled out dry hole marker and install wellhead.  
5-2-90. Spudded w/12 1/4" bit 10:00 AM 5-2-90. Clean out to 451'. No cement at shoe at 431'.  
POH w/12 1/4" bit from 660-685'. Appears to be large washout with lots of fill.  
5-3-90. Clean out to 1018'. Pick up 12 1/4" bit, swivel and start reaming.  
5-4 - 5-6-90. Reamed and cleaned out hole to 1212'.  
5-7-90. Ran 24 joints 8-5/8" set at 1024'. Cemented w/300 sx Class C w/2% CaCl. PD 9:45.  
AM 5-7-90. WOC 8 hrs. NU wellhead. TIH w/7-7/8" bit. Start drilling thru cement  
at 923' and continue 1040'. Clean out to 1161'.

*Minimum WOC is 12 hrs*

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *Juanita Goodlett* TITLE Production Supervisor DATE 5-8-90  
TYPE OR PRINT NAME Juanita Goodlett TELEPHONE NO. 505/748-1471

(This space for State Use)

Orig. Signed by  
Paul Kautz  
Geologist

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE MAY 11 1990

CONDITIONS OF APPROVAL, IF ANY:

MAY 10 1990

OCD  
HOBBS OFFICE