

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

# OIL CONSERVATION DIVISION

P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO.  
20-025-21287 ✓

5. Indicate Type of Lease  
STATE  FEE

6. State Oil & Gas Lease No.  
K-1038

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name  
State "C"

1. Type of Well:  
OIL WELL  GAS WELL  OTHER P&A

8. Well No.  
1

2. Name of Operator  
YATES PETROLEUM CORPORATION

9. Pool name or Wildcat  
Nonombre Upper Penn

3. Address of Operator  
105 South 4th St., Artesia, NM 88210

4. Well Location  
Unit Letter K : 1980 Feet From The South Line and 1980 Feet From The West Line  
Section 32 Township 13S Range 34E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)  
3168' KB

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: _____ <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: _____ <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged and abandoned well as follows:  
 Set CIBP 10475', cap with 35' cement.  
 Set CIBP 10250'. cap with 25. sx cement.  
 Spot 35 sx cement plug @ 8000'.  
 Spot 35 sx cement plug @ 6200'.  
 Shot 4 holes at 4350', set cement retainer at 4250' and squeezed w/75 sacks. Dump 35' on top.  
 Shot 4 holes at 1849', set cement retainer at 1800'.and squeezed w/75 sacks. Dump 35' on top.  
 Shot 4 holes at 475'. Tie on to 5-1/2" casing. Pumped 100 sx cement down 5-1/2" caisng.  
 Back to surface out of 8-5/8" casing. Tagged plug at 36'.  
 Spotted 10 sx surface plug.  
 Used 25#/bbl salt gel mud between plugs.  
 Approval obtained from Paul Kautz, NMOCD, Hobbs, NM, to plug well.  
 Installed regulation abandonment marker. Plugging completed 4-28-93

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Juanita Goodlett TITLE Production Supervisor DATE 4-30-93  
 TYPE OR PRINT NAME Juanita Goodlett TELEPHONE NO. 505/748-1471

(This space for State Use)

APPROVED BY Carmy M. Hill TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

OIL & GAS INSPECTOR AUG 18 1993

8