

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs NM 88241-1980

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

2040 Pacheco St.  
Santa Fe, NM 87505

WELL API NO.	30-025-30201
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	Humble Hume 5 State
8. Well No.	1
9. Pool name or Wildcat	Wildcat San Andres
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	4137.8' GL

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	2. Name of Operator Santa Fe Energy Resources, Inc.
3. Address of Operator 550 W. Texas, Suite 1330, Midland, TX 79701	4. Well Location Unit Letter <u>W</u> : <u>660</u> Feet From The <u>South</u> Line and <u>1980</u> Feet From The <u>East</u> Line Section <u>5</u> Township <u>16S</u> Range <u>34E</u> NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4137.8' GL	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data  
**NOTICE OF INTENTION TO:**

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: Plug back ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2/12/98: MIRU.  
2/14/98: Set CIBP at 10,050' and dump bailed 2 sx of cement on top. RIH w/ tubing to 7244'.  
2/15/98: Pumped 25 sx cement plug @ 7244'.  
2/17/98: RIH & tagged TOC @ 6814'. Spot 250 gal 15% NeFe HCl. Correlate on depth and perforate the San Andres w/4" csg guns at 4984-90' & 5032-40' (16 holes).  
2/19/98: RU Fracmaster and acidize w/ 2500 gal 15% NeFe HCl & 16 ball sealers.  
2/21/98: RU Fracmaster and acidize w/ 7500 gals 20% HCl gelled acid dropping 20 ball sealers. RU swab and begin swabbing.  
2/24/98: RIH w/ rods and pump. Balance unit and place well on production test.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Terry McCullough TITLE Sr. Production Clerk DATE 3/17/98

TYPE OR PRINT NAME Terry McCullough TELEPHONE NO. 915/687-3551

(This space for State Use)

ORIGINAL SIGNED BY CHRIS WILLIAMS  
DISTRICT I SUPERVISOR

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

IC

2A 12 Hume Williams do