

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals & Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P. O. Box 1980, Hobbs, NM 88240

DISTRICT II
P. O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P. O. Box 2088
Santa Fe, NM 87504-2088

WELL API NO. 30-025-33263
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B-2148

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Lease Name or Unit Agreement Name Caprock Maljamar Unit
2. Name of Operator The Wiser Oil Company	8. Well No. 146
3. Address of Operator P.O. Box 2568 Hobbs, New Mexico 88241 (505) 392-9797	9. Pool name or Wildcat Maljamar Grayburg San Andres
4. Well Location Unit Letter <u>P</u> : <u>1310</u> Feet From The <u>South</u> Line and <u>1310</u> Feet From The <u>East</u> ine Section <u>13</u> Township <u>17S</u> Range <u>32E</u> NMPM <u>Lea</u> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4102' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: _____ <input type="checkbox"/>		OTHER: <u>Re-perforate & acidize</u> <input checked="" type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

02/08/01 MIRU Tyler WS # 103. POH w/rods & pump. Dropped standing valve. Pressured tbg. to 500#. Would not hold. ND WH. RU BOP. Tbg. stuck. Could not fish standing valve. RU Rotary WL. RIH w/free point. Tagged standing valve @ 4150'. POH to 4135'. RIH w/chemical cutters. Cut tbg. off @ 4120'. RD WL. POH w/2-7/8" tbg. LD TAC & 1/2 jt. of 2-7/8" tbg. RIH w/overshot, bumper sub, jars, DC's & 2-7/8" tbg. Caught fish @ 4120'. Jarred out to 4108'.

02/09/01 Jarred out to 4105' & parted tbg. POH w/2-7/8" tbg. LD 1/2 jt. from chemical cutters & 1/2 jt. parted from fish.

02/10/01 RIH w/4-3/4" cutrite shoe & wash pipe on 2-7/8" tbg. to 4150'. Washed over fish to 4156'. POH w/tbg. LD tools.

02/12/01 RIH w/tbg. & tools to 4156'. Washed to 4158'. POH w/tbg. & tools. LD shoe. RIH w/tbg. & tools to 4158'. Washed over to 4159'. POH to 4120'.

02/13/01 RIH to 4159'. Washed over fish to 4163'. POH w/2-7/8" tbg., DC's, & wash pipe. LD shoe. RIH w/overshot, bumper sub, jars, DC's & 2-7/8" tbg. Caught fish @ 4149'. POH w/tbg., DC's & tools. LD overshot & fish.

07/14/01 RIH w/4-3/4" mill & DC's on 2-7/8" tbg. to 4157'. Milled to 4180'. Lost circulation. POH w/tbg. & DC's. LD mill.

07/15/01 RIH w/4-3/4" cutrite shoe, wash pipe & DC's on 2-7/8" tbg. Tagged @ 4180'. Washed over to 4207'. POH w/2-7/8" tbg. & tools. Caught fish. RD reverse unit. RU Computalog WL & perforated Grayburg f/4031'-33',55',74',85',86',4117',18',28',34',40',44',68',72',80',84',86',88',91',93' w/4

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mary Jo Turner TITLE Production Tech II DATE September 3, 2001
 TYPE OR PRINT NAME Mary Jo Turner TELEPHONE NO. 392-9797

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE 09/23/01