

to Appropriate District Office

Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

DISTRICT I P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION P.O. Box 2088 Santa Fe, New Mexico 87504-2088

DISTRICT II P.O. Drawer DD, Artesia, NM 88210

DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO. 30-025-02326

5. Indicate Type of Lease STATE [X] FEE []

6. State Oil & Gas Lease No. B-871

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name Vacuum Grayburg San Andres Unit

1. Type of Well: OIL WELL [X] GAS WELL [] OTHER []

8. Well No. 3

2. Name of Operator Texaco E&P Inc.

9. Pool name or Wildcat Vacuum GB/SA

3. Address of Operator PO Box 3109 Midland, TX 79702

4. Well Location Unit Letter C : 330 Feet From The North Line and 2310 Feet From The West Line

Section 12 Township 18S Range 34E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3994 DF

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data. NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK [], PLUG AND ABANDON [X], TEMPORARILY ABANDON [], CHANGE PLANS [], PULL OR ALTER CASING [], OTHER: []. SUBSEQUENT REPORT OF: REMEDIAL WORK [], ALTERING CASING [], COMMENCE DRILLING OPNS. [], PLUG AND ABANDONMENT [], CASING TEST AND CEMENT JCB [], OTHER: []

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1. Notify NMOCDD of intent to plug & abandon well.
2. RIH w/tub @ 4115' tag cmt. circ. csg. w/25# per bbl salt gel mud to surface.
3. POOH to 3900'. Spot 25sx cmt. plug (Queens).
4. POOH to 2900'. Spot 75sx cmt. plug 2900-2600 (lower salt section & Yates)
5. POOH to 1700'. Spot 75sx cmt. plug 1700-1350 (upper salt section)
6. TIH w/CICR set @ 830 sq. csg. leaks 998 & 1059 w/300sx class C cmt. If cmt. circ. to surface (proceed to step #7)
7. Spot 25sx class C cmt. 830-730 (8-5/8" shoe)
8. POOH to 400'. Spot @ 65sx f/400-surface (fresh water zone)
9. Dig out cellar & cut off well head; cap well & install dry hole marker. RD Pool clean location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Operations Engineer DATE 2-20-95

TYPE OR PRINT NAME RJ Harding III TELEPHONE NO. 915-688-4816

(This space for State Use) ORDERED BY: JIMMY D. SEXTON DISTRICT SUPERVISOR

MAR 08 1995

APPROVED BY: TITLE: DATE:

CONDITIONS OF APPROVAL IF ANY: