


PLUG AND ABANDON PROCEDURE

Notify USGS, OCC and offset operators of intent to plug and abandon.

1. Displace 7" casing with gelled mud (25 sacks gel in 100 barrels produced water).
2. Spot 100' cement plug at 3980'.
3. Cut and pull 7" casing.
4. Cut and pull 9 5/8" casing. Spot 100' cement plug in casing or at top of anhydrite at 1400', whichever is higher.
5. Spot 100' cement plug at 13 3/8" casing shoe.
6. Spot 20' cement plug at surface.
7. Rig wellhead for abandonment and install marker.

NOTE: Follow each cement plug with gelled mud.

NO AFE - Charge LC-652


S.E. Barker

HNS/sm
6-26-72