

**UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY**

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well gas well other

2. NAME OF OPERATOR
Sun Exploration & Production Co.

3. ADDRESS OF OPERATOR
P.O. Box 1861, Midland, TX 79702

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: Unit Ltr. D, 660'FNL & 660'FWL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:		SUBSEQUENT REPORT OF:
TEST WATER SHUT-OFF	<input type="checkbox"/>	<input type="checkbox"/>
FRACTURE TREAT	<input type="checkbox"/>	<input type="checkbox"/>
SHOOT OR ACIDIZE	<input type="checkbox"/>	<input type="checkbox"/>
REPAIR WELL	<input type="checkbox"/>	<input type="checkbox"/>
PULL OR ALTER CASING	<input type="checkbox"/>	<input type="checkbox"/>
MULTIPLE COMPLETE	<input type="checkbox"/>	<input type="checkbox"/>
CHANGE ZONES	<input type="checkbox"/>	<input type="checkbox"/>
ABANDON*	<input type="checkbox"/>	<input checked="" type="checkbox"/>
(other)	<input type="checkbox"/>	<input type="checkbox"/>

5. LEASE
NM 12412

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Sloan Federal

9. WELL NO.
1

10. FIELD OR WILDCAT NAME
East Lusk Wolfcamp

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 22, T-19-S, R-32-E

12. COUNTY OR PARISH
Lea

13. STATE
New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

7-20. MIRU X-pert WS, Install BOP, TIH w/ 2-7/8" WS, tag cmt retainer @ 2849, circ hole w/ 9.5# mud, POH w/ 2-7/8 WS, TIH w/ Howco CIBP on 2-7/8 WS to 2600', Set CIBP, POH w/ setting tool.

7-21. TIH w/ 2-7/8 WS open end to 2600, tag CIBP, Howco spot 35 sxs class 'C' cmt plug from 2600-2497', Pull to 1008', Howco spot 35 sxs class 'C' cmt plug from 1008-902', Pull up to 62' spot 20 sxs cmt plug to surface, cut off 4' below grd-level, weld on steel plate, install dry hole markers.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Dee Ann Kemp TITLE Associate Acct. DATE July 30, 1984

Orig: Sgt. Charles S. D. [Signature] (This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE 7-16-86

CONDITIONS OF APPROVAL, IF ANY: